


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                                 |                                         |             |
|-----------------------------------------|---------------------------------|-----------------------------------------|-------------|
| Intersection ID: 10014702               | Main Street: PERIWINKLE_HILL_AV | Cross Street: N/A                       | Location: E |
| ADA ID: 7B08F6E2566F                    | Overall Compliance: No          | Severity Score: 10                      |             |
| Codes/Mitigation Info/Possible Solution |                                 | Field Measurements/Component Compliance |             |

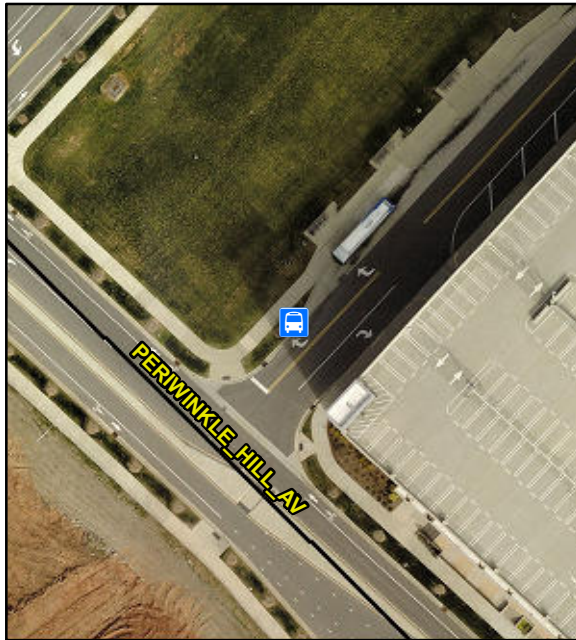

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove or Relocate  
Protruding Objects/Obstructions.**

Surveyor Notes:

**Transit stop is further NE from point  
outside collection area**

PROW/ADA:

**402.2, 810.2.3, 810.2.4, R302, R302.6,  
R308.1.1.2**

CATS Stop ID: **60310**  
CATS Stop Description: **UCB Station Bay**  
CATS Route ID: **50, 54**  
CATS Route Name: **Multiple**

Total Cost: \$ **3450.00**

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 138.0 |
| Yes        | Boarding Area Length (in)       | 96.0  |
| No         | Boarding Area Slope %           | 2.2   |
| Yes        | Boarding Area XSlope %          | 0.9   |
| Yes        | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 72.0  |
| Yes        | PAR 1 Slope %                   | 1.1   |
| Yes        | PAR 1 XSlope %                  | 0.4   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| No         | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 65.0  |
| Yes        | PAR 2 Slope %                   | 2.0   |
| No         | PAR 2 XSlope %                  | 2.4   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 2.0   |
| N/A        | Shelter                         | Yes   |
| Yes        | Clear Floor Space               | Yes   |
| N/A        | Clear Floor Space Shelter       | Yes   |
| Yes        | Clear Floor Space Width (in)    | 48.0  |
| Yes        | Clear Floor Space Length (in)   | 62.0  |
| Yes        | Clear Floor Space Slope %       | 1.5   |
| Yes        | Clear Floor Space XSlope %      | 1.1   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 98.0  |
| N/A        | Bench?                          | Yes   |
| No         | Protruding Objects?             | Yes   |

