


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                           |                              |                    |             |
|---------------------------|------------------------------|--------------------|-------------|
| Intersection ID: 10032177 | Main Street: MORRIS_FIELD_DR | Cross Street: N/A  | Location: S |
| ADA ID: 7D938102F22B      | Overall Compliance: No       | Severity Score: 35 |             |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

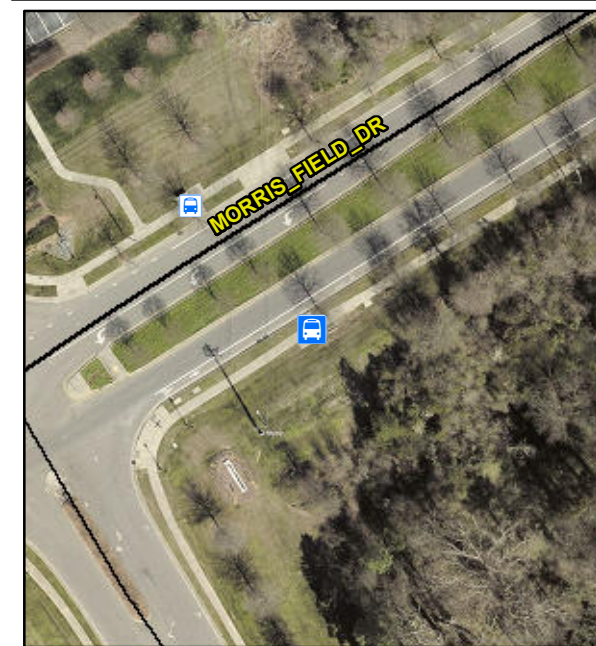

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove & Replace  
Clear Floor Space.**

Surveyor Notes:

**N/A**

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,  
810.2.4, 810.3, R302, R302.5, R302.6,  
R308.1.1.1, R308.1.1.2, R404.1,  
R404.2**

CATS Stop ID: 20281

CATS Stop Description: Morris Field Dr & CPCC Harris Campus Dr

CATS Route ID: 235

CATS Route Name: Goodwill / Amay James

Total Cost: \$ 2650.00

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| No         | Boarding Area Width (in)        | 59.0  |
| Yes        | Boarding Area Length (in)       | 126.0 |
| No         | Boarding Area Slope %           | 5.4   |
| Yes        | Boarding Area XSlope %          | 1.4   |
| No         | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 61.0  |
| Yes        | PAR 1 Slope %                   | 1.8   |
| No         | PAR 1 XSlope %                  | 2.8   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| No         | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 61.0  |
| No         | PAR 2 Slope %                   | 3.0   |
| No         | PAR 2 XSlope %                  | 2.3   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 2.7   |
| N/A        | Shelter                         | No    |
| No         | Clear Floor Space               | Yes   |
| N/A        | Clear Floor Space Shelter       | No    |
| Yes        | Clear Floor Space Width (in)    | 92.0  |
| Yes        | Clear Floor Space Length (in)   | 53.5  |
| No         | Clear Floor Space Slope %       | 2.5   |
| No         | Clear Floor Space XSlope %      | 3.1   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 96.0  |
| N/A        | Bench?                          | Yes   |
| Yes        | Protruding Objects?             | No    |

