


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10036646	Main Street: S_BREVARD_ST	Cross Street: N/A	Location: N
ADA ID: 7E3EBC1DF606	Overall Compliance: No	Severity Score: 15	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

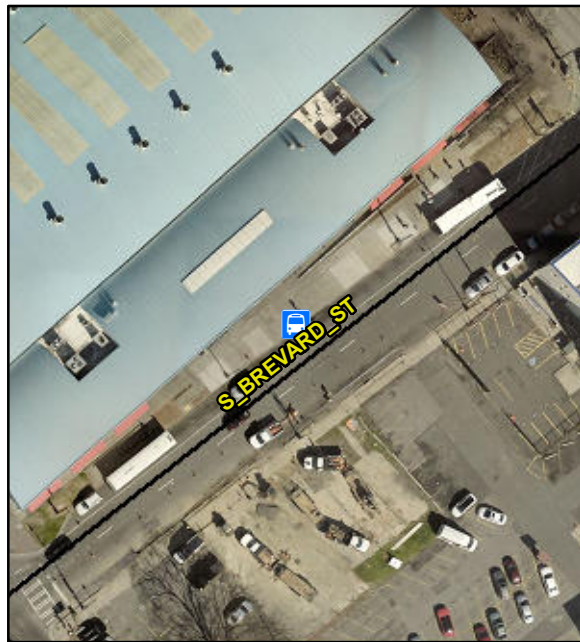

Possible Solutions:

Remove & Replace Clear Floor Space.

Surveyor Notes:

CATS ID NOT LISTED AT TRANSIT STOP

PROW/ADA:

305.2, 305.3, 810.3, R404.1, R404.2, R404.3

CATS Stop ID: **45102**

CATS Stop Description: **Transit Center- Bay V**

CATS Route ID: **20, 27, 5, 9**

CATS Route Name: **Multiple**

Total Cost: \$ **500.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	143.0
Yes	Boarding Area Length (in)	153.0
Yes	Boarding Area Slope %	0.7
Yes	Boarding Area XSlope %	1.3
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	143.0
Yes	PAR 1 Slope %	1.2
Yes	PAR 1 XSlope %	0.0
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	143.0
Yes	PAR 2 Slope %	1.3
Yes	PAR 2 XSlope %	0.1
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.9
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	57.0
No	Clear Floor Space Length (in)	25.0
No	Clear Floor Space Slope %	2.3
Yes	Clear Floor Space XSlope %	0.2
N/A	Alcove Condition?	Yes
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	98.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

