


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10020327	Main Street: BALDWIN_AV	Cross Street: N/A	Location: S
ADA ID: 836352F485B5	Overall Compliance: No	Severity Score: 35	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

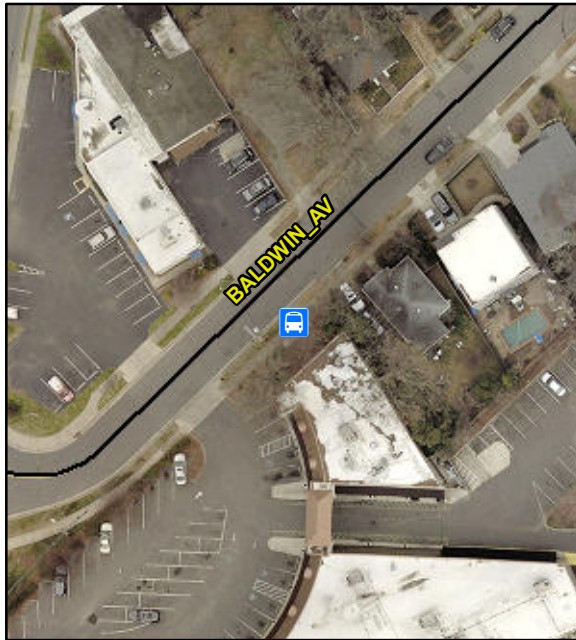

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.5, R308.1.1.2, R404.1,
R404.2**

CATS Stop ID: **01460**

CATS Stop Description: **Baldwin Ave & Kings Dr**

CATS Route ID: **6**

CATS Route Name: **Kings Drive**

Total Cost: \$ **1950.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	2.3
Yes	Boarding Area XSlope %	4.0
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	4.4
No	PAR 1 XSlope %	2.6
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	4.5
Yes	PAR 2 XSlope %	1.7
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	5.1
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	146.0
Yes	Clear Floor Space Length (in)	48.0
No	Clear Floor Space Slope %	2.4
No	Clear Floor Space XSlope %	4.7
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

