


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10014173	Main Street: THE_PLAZA	Cross Street: N/A	Location: S
ADA ID: 83CD04DD5800	Overall Compliance: No	Severity Score: 35	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

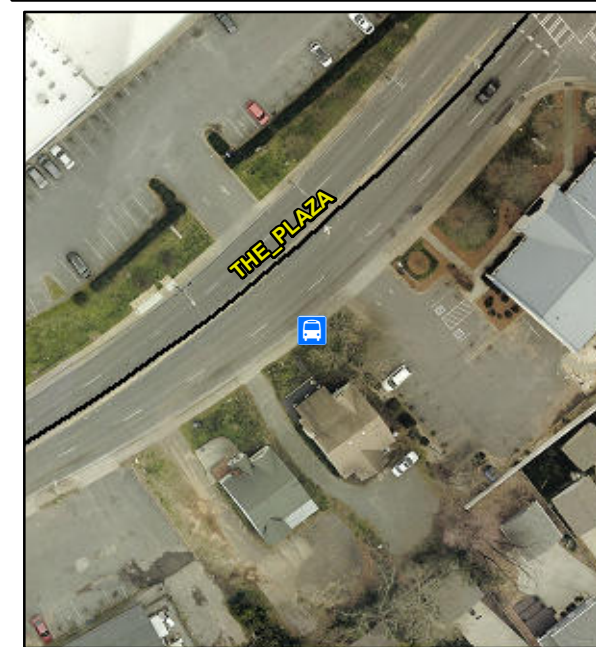

Possible Solutions:

**Remove & Replace Boarding Area.
Remove or Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

810.2.2, R308.1.1.1

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	66.0
Yes	Boarding Area Slope %	0.7
Yes	Boarding Area XSlope %	1.4
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	1.4
Yes	PAR 1 XSlope %	0.7
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	2.0
Yes	PAR 2 XSlope %	1.7
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.3
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	No
No	Protruding Objects?	Yes

CATS Stop ID: 31370

CATS Stop Description: **The Plaza & Matheson Ave**

CATS Route ID: 4

CATS Route Name: **Belmont**

Total Cost: \$ 2750.00

