


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10012087	Main Street: CINDY_LN	Cross Street: N/A	Location: N
ADA ID: 84068EF7D72E	Overall Compliance: No	Severity Score: 80	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

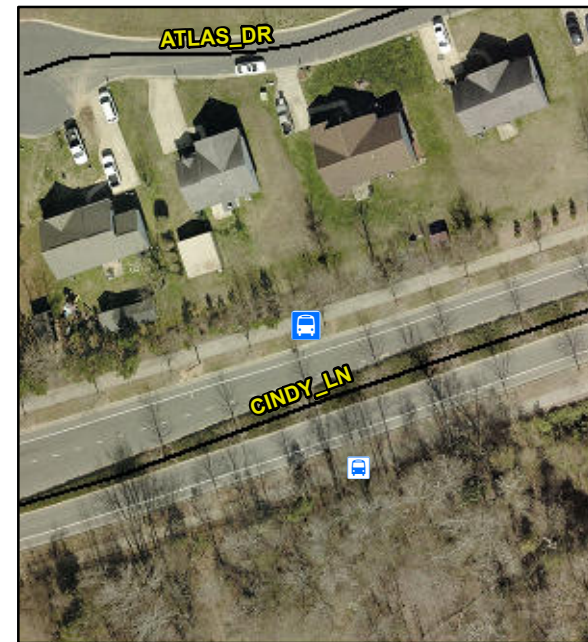

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area. Provide Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

CATS ID LISTED AS 1953 - LAST NUMBER ILLEGIBLE

PROW/ADA:

402.2, 810.2, 810.2.3, 810.3, R302, R302.5, R302.6, R308.1.1, R404.1

CATS Stop ID: 19535

CATS Stop Description: Cindy Ln & Statesville Rd

CATS Route ID: 13

CATS Route Name: Nevin Road

Total Cost: \$ 4550.00

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	85.0
No	PAR 1 Slope %	2.9
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	85.0
No	PAR 2 Slope %	3.2
No	PAR 2 XSlope %	2.9
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	1.9
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	96.5
N/A	Bench?	Yes
No	Protruding Objects?	Yes

