


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10022801	Main Street: CASCADE_POINTE_BV	Cross Street: N/A	Location: W
ADA ID: 84765E376E10	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

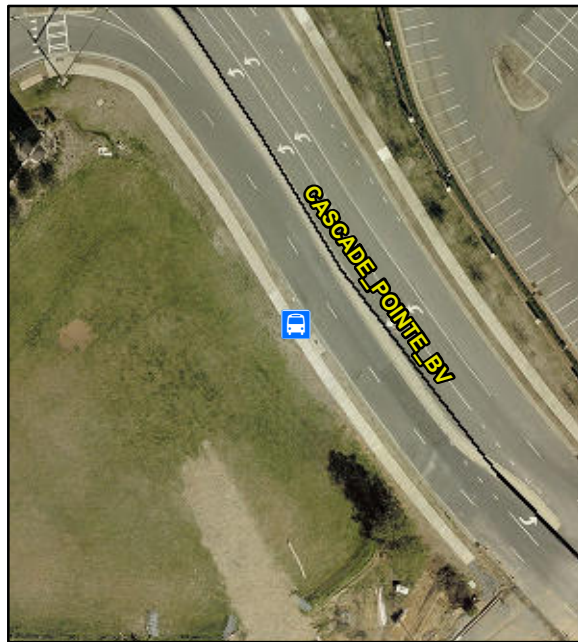

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.3, 810.2.4, R302, R302.6,
R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	136.0
Yes	Boarding Area Length (in)	125.0
No	Boarding Area Slope %	6.7
Yes	Boarding Area XSlope %	3.1
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	72.0
No	PAR 1 Slope %	3.8
Yes	PAR 1 XSlope %	0.7
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	72.0
Yes	PAR 2 Slope %	2.7
Yes	PAR 2 XSlope %	1.4
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.6
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 59460

CATS Stop Description: Cascade Pointe Blvd & W Tyvola Rd

CATS Route ID: 60

CATS Route Name: Tyvola Road

Total Cost: \$ 1450.00

