


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10041333	Main Street: WEST_BV	Cross Street: ROMARE_BEARDEN_DR	Location: S
ADA ID: 86261AFE8381	Overall Compliance: No	Severity Score: 15	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

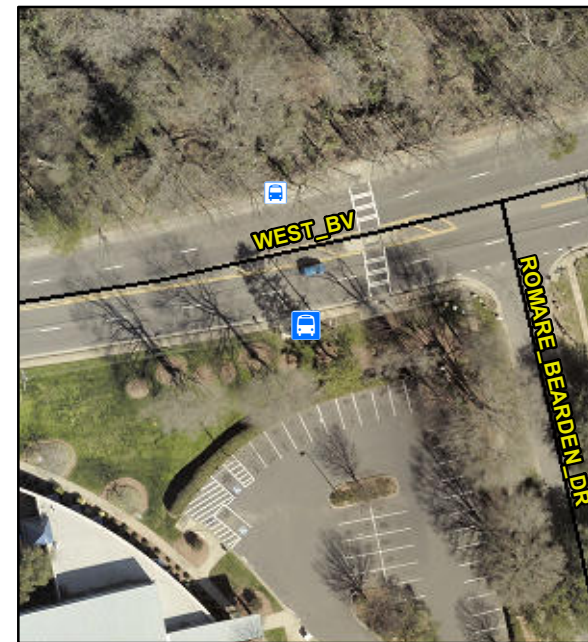

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.6, R308.1.1.2, R404.1,
R404.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	120.0
Yes	Boarding Area Length (in)	96.0
Yes	Boarding Area Slope %	1.8
No	Boarding Area XSlope %	2.9
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	48.0
No	PAR 1 Slope %	3.3
Yes	PAR 1 XSlope %	2.0
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	48.0
Yes	PAR 2 Slope %	2.5
No	PAR 2 XSlope %	2.1
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.6
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	47.0
Yes	Clear Floor Space Length (in)	66.0
Yes	Clear Floor Space Slope %	1.0
No	Clear Floor Space XSlope %	2.8
N/A	Alcove Condition?	Yes
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	91.5
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 34400

CATS Stop Description: **West Blvd & Romare Bearden Dr**

CATS Route ID: 10

CATS Route Name: **West Boulevard**

Total Cost: \$ 4650.00

