


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10015857	Main Street: BELMONT_AV	Cross Street: N/A	Location: S
ADA ID: 8750388FDB5B	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

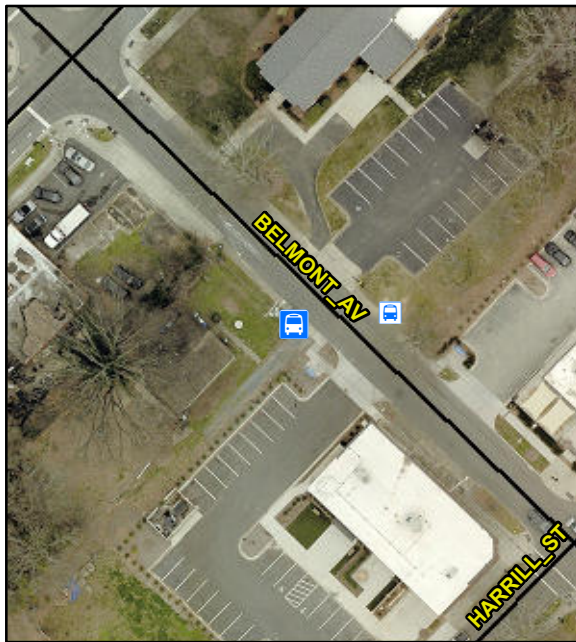

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 403.5.1, 810.2.2, 810.2.3,
810.2.4, R302, R302.3, R302.5,
R302.6, R308.1.1.1, R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	54.0
No	Boarding Area Slope %	3.7
Yes	Boarding Area XSlope %	5.4
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	38.0
Yes	PAR 1 Slope %	5.4
No	PAR 1 XSlope %	3.7
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
No	PAR 2 Width (in)	38.0
Yes	PAR 2 Slope %	5.6
No	PAR 2 XSlope %	3.9
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	5.9
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	100.0
N/A	Bench?	No
No	Protruding Objects?	Yes

CATS Stop ID: 03010

CATS Stop Description: **Belmont Ave & Seigle Ave**

CATS Route ID: 4

CATS Route Name: **Belmont**

Total Cost: \$ 4150.00

