


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10032545	Main Street: N_DAVIDSON_ST	Cross Street: E_5TH_ST	Location: E
ADA ID: 89F3CEDE7D47	Overall Compliance: No	Severity Score: 40	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

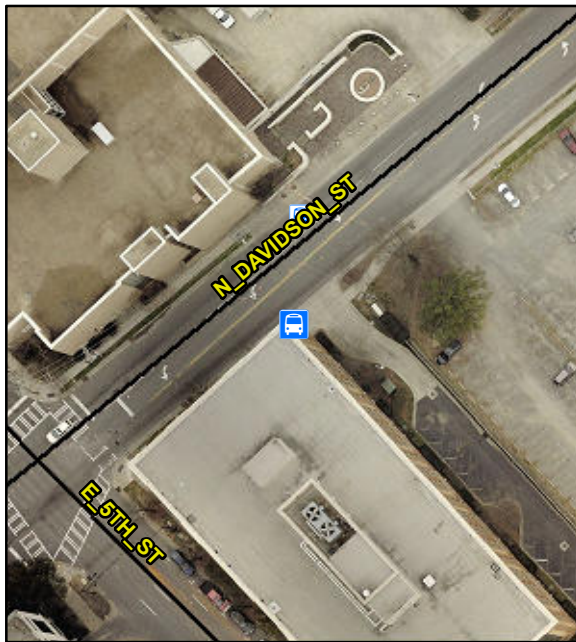

Possible Solutions:

**Remove & Replace Boarding Area.
Provide Clear Floor Space. Remove
or Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

810.2.4, 810.3, R308.1.1.2, R404.1

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	144.0
No	Boarding Area Slope %	3.9
Yes	Boarding Area XSlope %	0.2
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	68.0
Yes	PAR 1 Slope %	1.7
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	106.0
Yes	PAR 2 Slope %	1.1
Yes	PAR 2 XSlope %	2.0
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.3
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	102.5
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 38580

CATS Stop Description: Davidson St & 5th St

CATS Route ID: 17, 23

CATS Route Name: Multiple

Total Cost: \$ 3200.00

