


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10027867	Main Street: HAMLIN_PARK_DR	Cross Street: N/A	Location: SW
ADA ID: 90C62D20288A	Overall Compliance: No	Severity Score: 90	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

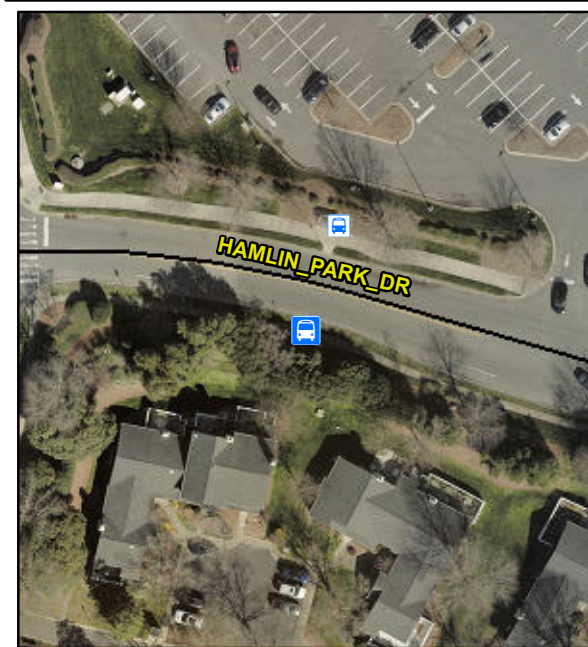

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 403.5.1, 810.2, 810.2.3, R302, R302.3, R302.5, R308.1.1

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	47.0
Yes	PAR 1 Slope %	2.3
No	PAR 1 XSlope %	3.0
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	3.5
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: **46185**

CATS Stop Description: **Hamlin Park Dr & Brandon Forest Dr**

CATS Route ID: **43**

CATS Route Name: **Ballantyne**

Total Cost: \$ **1400.00**

