


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037051	Main Street: S_TRYON_ST	Cross Street: N/A	Location: E
ADA ID: 913AF7316EB6	Overall Compliance: No	Severity Score: 40	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

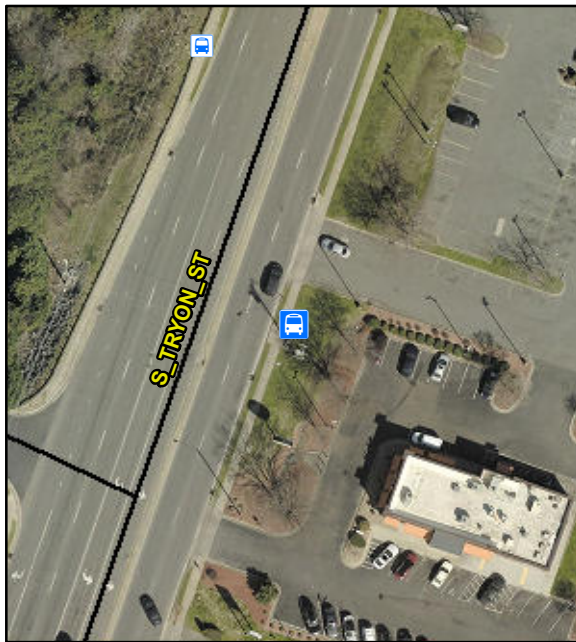

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Provide Clear Floor
Space. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4,
810.3, R302, R302.5, R302.6,
R308.1.1.1, R308.1.1.2, R404.1**

CATS Stop ID: **46169**

CATS Stop Description: **Tryon St & Arrowood Rd**

CATS Route ID: **16, 41x**

CATS Route Name: **Multiple**

Total Cost: \$ **4600.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	118.0
No	Boarding Area Length (in)	84.0
Yes	Boarding Area Slope %	1.2
No	Boarding Area XSlope %	2.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	0.9
No	PAR 1 XSlope %	4.5
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	0.8
No	PAR 2 XSlope %	5.6
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.6
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

