


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                        |                                         |             |
|-----------------------------------------|------------------------|-----------------------------------------|-------------|
| Intersection ID: N/A                    | Main Street: E 4TH ST  | Cross Street: N/A                       | Location: E |
| ADA ID: 95E14B14EF82                    | Overall Compliance: No | Severity Score: 20                      |             |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |             |

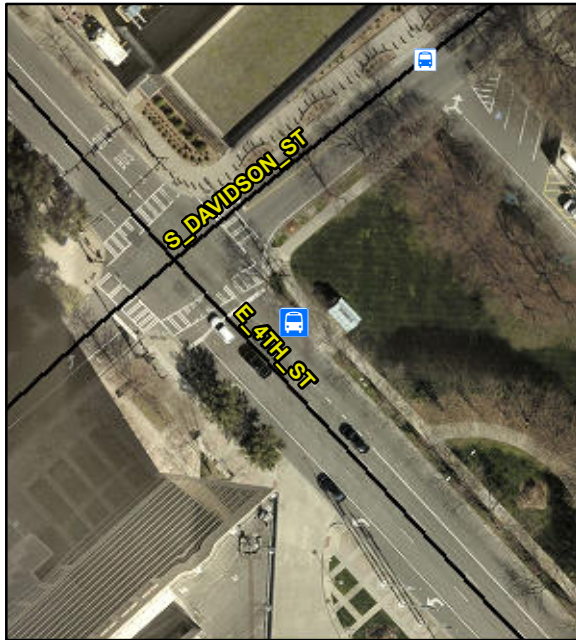

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove & Replace  
Clear Floor Space. Remove or  
Relocate Protruding  
Objects/Obstructions.**

Surveyor Notes:

**CATS ID NOT LABELED.**

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,  
R302, R302.5, R308.1.1.2, R404.1,  
R404.2**

CATS Stop ID: **07380**

CATS Stop Description: **4th St & Davidson St**

CATS Route ID: **14, 15, 20, 41x, 48x, 53x, 6, 61x, 62x, 74x, 77x, 82x, 85x, 88x**

CATS Route Name: **Multiple**

Total Cost: \$ **4650.00**

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 120.0 |
| Yes        | Boarding Area Length (in)       | 151.0 |
| No         | Boarding Area Slope %           | 2.2   |
| Yes        | Boarding Area XSlope %          | 0.5   |
| No         | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 73.0  |
| Yes        | PAR 1 Slope %                   | 1.6   |
| No         | PAR 1 XSlope %                  | 2.5   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| No         | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 73.0  |
| No         | PAR 2 Slope %                   | 3.3   |
| Yes        | PAR 2 XSlope %                  | 0.3   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 2.3   |
| N/A        | Shelter                         | Yes   |
| No         | Clear Floor Space               | Yes   |
| N/A        | Clear Floor Space Shelter       | Yes   |
| Yes        | Clear Floor Space Width (in)    | 54.0  |
| Yes        | Clear Floor Space Length (in)   | 66.0  |
| No         | Clear Floor Space Slope %       | 3.4   |
| Yes        | Clear Floor Space XSlope %      | 2.0   |
| N/A        | Alcove Condition?               | Yes   |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 81.0  |
| N/A        | Bench?                          | Yes   |
| No         | Protruding Objects?             | Yes   |

