


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10040526	Main Street: W_5TH_ST	Cross Street: N_CEDAR_ST	Location: S
ADA ID: 970EBA83D924	Overall Compliance: No	Severity Score: 40	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

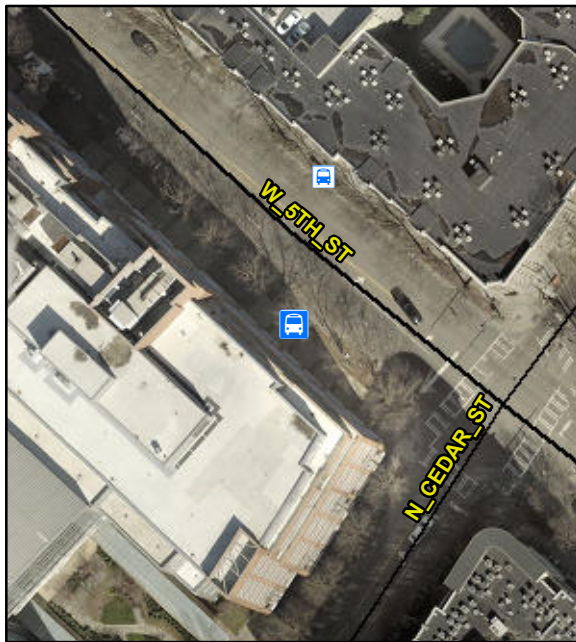

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

**METAL GRADING WITHING
BOARDING ARWA**

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,
R302.6, R308.1.1.1, R308.1.1.2**

CATS Stop ID: **21512**
CATS Stop Description: **5th St & Cedar St**
CATS Route ID: **1, 7**
CATS Route Name: **Multiple**

Total Cost: \$ **4150.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	222.0
No	Boarding Area Length (in)	78.0
Yes	Boarding Area Slope %	1.4
No	Boarding Area XSlope %	3.8
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	156.0
No	PAR 1 Slope %	2.3
Yes	PAR 1 XSlope %	1.3
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	156.0
Yes	PAR 2 Slope %	1.6
No	PAR 2 XSlope %	2.3
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.9
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
No	Protruding Objects?	Yes

