


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10026303	Main Street: FAIRVIEW_RD	Cross Street: WINTERCREST_LN	Location: S
ADA ID: 9D12A0E2A7A6	Overall Compliance: No	Severity Score: 15	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

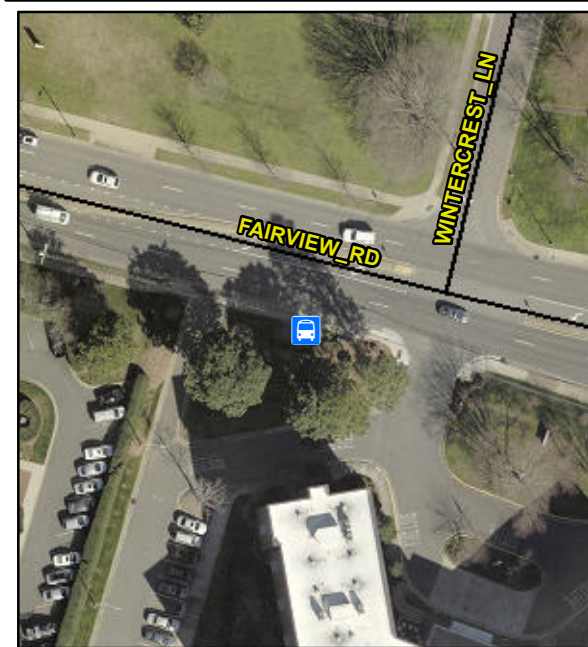

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 810.2.3, 810.2.4, 810.3,
R302, R302.5, R302.6, R308.1.1.2,
R404.1, R404.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	100.0
No	Boarding Area Slope %	2.1
Yes	Boarding Area XSlope %	0.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	71.0
Yes	PAR 1 Slope %	0.3
No	PAR 1 XSlope %	2.1
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	71.0
Yes	PAR 2 Slope %	0.5
No	PAR 2 XSlope %	4.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.2
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	67.5
Yes	Clear Floor Space Length (in)	85.0
No	Clear Floor Space Slope %	2.1
Yes	Clear Floor Space XSlope %	0.8
N/A	Alcove Condition?	Yes
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 10410

CATS Stop Description: Fairview Rd & Wintercrest Ln

CATS Route ID: 19

CATS Route Name: Park Road

Total Cost: \$ 4650.00

