


# Access Compliance Report

## Public Rights-of-Way

### (Transit Stops)

|                                         |                        |                                         |             |
|-----------------------------------------|------------------------|-----------------------------------------|-------------|
| Intersection ID: 8988                   | Main Street: NORRIS_AV | Cross Street: OLANDO_ST                 | Location: N |
| ADA ID: A1CE5FC663BF                    | Overall Compliance: No | Severity Score: 55                      |             |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |             |

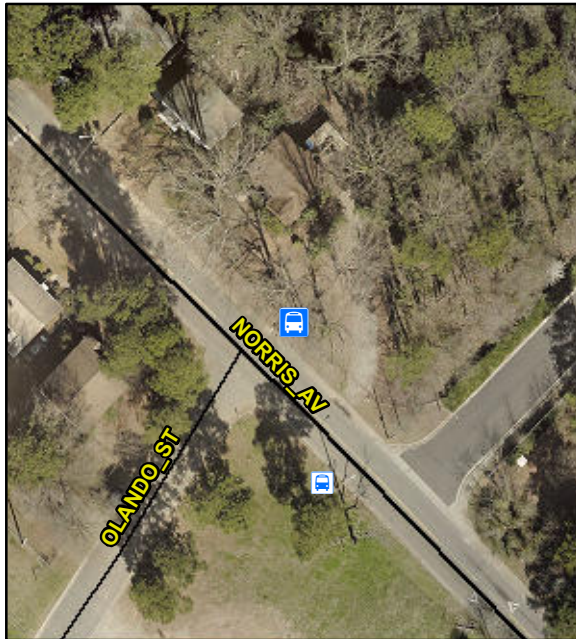

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove or Relocate  
Protruding Objects/Obstructions.**

Surveyor Notes:

**CURB WIDTH 16.0 IN**

PROW/ADA:

**402.2, 403.5.1, 810.2.2, 810.2.3,  
810.2.4, R302, R302.3, R302.5,  
R302.6, R308.1.1.1, R308.1.1.2**

CATS Stop ID: **45725**

CATS Stop Description: **Norris Ave & Orlando St**

CATS Route ID: **3**

CATS Route Name: **The Plaza**

Total Cost: \$ **4150.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| No         | Boarding Area Length (in)       | 54.0 |
| No         | Boarding Area Slope %           | 4.7  |
| Yes        | Boarding Area XSlope %          | 2.4  |
| No         | PAR 1 Exist?                    | Yes  |
| No         | PAR 1 Width (in)                | 38.0 |
| Yes        | PAR 1 Slope %                   | 2.4  |
| No         | PAR 1 XSlope %                  | 4.7  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| No         | PAR 2 Width (in)                | 38.0 |
| No         | PAR 2 Slope %                   | 2.8  |
| No         | PAR 2 XSlope %                  | 5.1  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 2.5  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 93.0 |
| N/A        | Bench?                          | No   |
| No         | Protruding Objects?             | Yes  |

