


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10328	Main Street: N_BREVARD_ST	Cross Street: N_DAVIDSON_ST	Location: S
ADA ID: A1D84E7D8F3E	Overall Compliance: No	Severity Score: 85	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

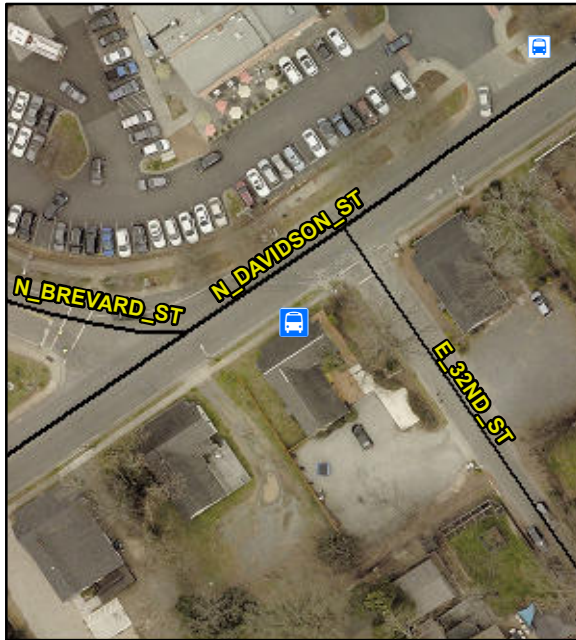

Possible Solutions:

Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 403.5.1, 810.2, 810.2.3, R302, R302.3, R308.1.1

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	44.0
Yes	PAR 1 Slope %	1.9
Yes	PAR 1 XSlope %	1.7
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
No	PAR 2 Width (in)	44.0
Yes	PAR 2 Slope %	2.0
Yes	PAR 2 XSlope %	1.0
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	1.6
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	91.5
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 17580

CATS Stop Description: Davidson St & 32nd St

CATS Route ID: 23, 3

CATS Route Name: Multiple

Total Cost: \$ 2100.00

