


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                            |                                         |             |
|-----------------------------------------|----------------------------|-----------------------------------------|-------------|
| Intersection ID: 10011407               | Main Street: N_DAVIDSON_ST | Cross Street: N/A                       | Location: S |
| ADA ID: AC0C660AC930                    | Overall Compliance: No     | Severity Score: 40                      |             |
| Codes/Mitigation Info/Possible Solution |                            | Field Measurements/Component Compliance |             |

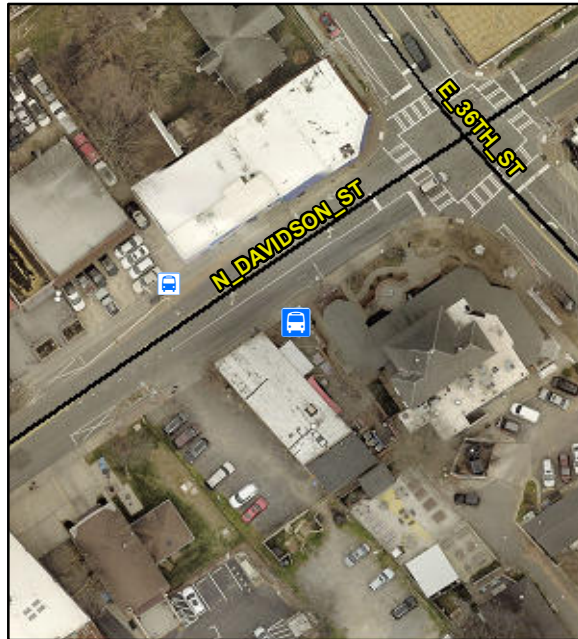

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove or Relocate  
Protruding Objects/Obstructions.**

Surveyor Notes:

**CATS ID NOT LISTED AT TRANSIT  
STOP**

PROW/ADA:

**402.2, 810.2.2, 810.2.3, 810.2.4, R302,  
R302.5, R308.1.1.1, R308.1.1.2**

CATS Stop ID: 17660

CATS Stop Description: Davidson St & 36th St

CATS Route ID: 23, 3

CATS Route Name: Multiple

Total Cost: \$ 3450.00

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 60.0 |
| No         | Boarding Area Length (in)       | 65.0 |
| No         | Boarding Area Slope %           | 2.7  |
| Yes        | Boarding Area XSlope %          | 0.1  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 59.0 |
| Yes        | PAR 1 Slope %                   | 0.1  |
| No         | PAR 1 XSlope %                  | 2.7  |
| N/A        | PAR 1 XSlope Location           | Perp |
| Yes        | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 59.0 |
| Yes        | PAR 2 Slope %                   | 0.4  |
| Yes        | PAR 2 XSlope %                  | 1.6  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 0.3  |
| N/A        | Shelter                         | No   |
| N/A        | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 90.5 |
| N/A        | Bench?                          | No   |
| No         | Protruding Objects?             | Yes  |

