


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                          |                                         |             |
|-----------------------------------------|--------------------------|-----------------------------------------|-------------|
| Intersection ID: -9999                  | Main Street: Catawba Ave | Cross Street: N/A                       | Location: N |
| ADA ID: B2A0720DFD3A                    | Overall Compliance: No   | Severity Score: 10                      |             |
| Codes/Mitigation Info/Possible Solution |                          | Field Measurements/Component Compliance |             |

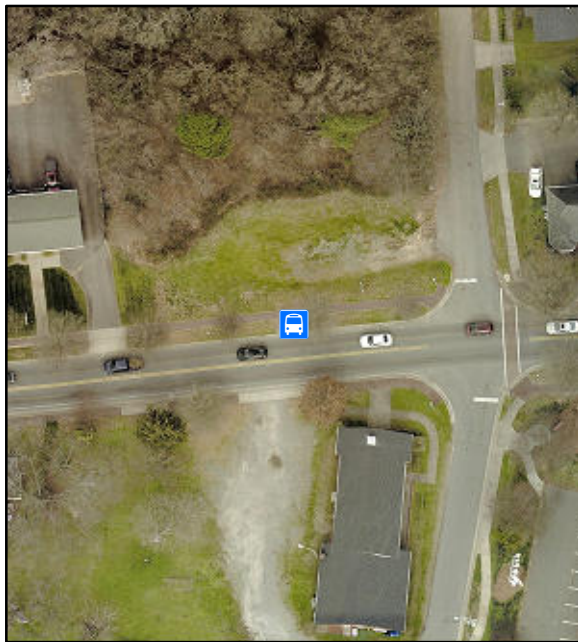

Possible Solutions:

**Remove & Replace Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.**

Surveyor Notes:

**FADED STICKER**

PROW/ADA:

**305.2, 810.3, R404.1, R404.2**

CATS Stop ID: 04935

CATS Stop Description: Catawba Ave & Ferry St

CATS Route ID: 77x, 97

CATS Route Name: Multiple

Total Cost: \$ 2500.00

| Compliance | Description                     | Data  |
|------------|---------------------------------|-------|
| Yes        | Boarding Area                   | Yes   |
| Yes        | Boarding Area Width (in)        | 64.0  |
| Yes        | Boarding Area Length (in)       | 149.5 |
| Yes        | Boarding Area Slope %           | 1.7   |
| Yes        | Boarding Area XSlope %          | 0.6   |
| Yes        | PAR 1 Exist?                    | Yes   |
| Yes        | PAR 1 Width (in)                | 53.0  |
| Yes        | PAR 1 Slope %                   | 1.4   |
| Yes        | PAR 1 XSlope %                  | 0.9   |
| N/A        | PAR 1 XSlope Location           | Perp  |
| Yes        | PAR 2 Exist?                    | Yes   |
| Yes        | PAR 2 Width (in)                | 53.0  |
| Yes        | PAR 2 Slope %                   | 2.0   |
| Yes        | PAR 2 XSlope %                  | 0.0   |
| N/A        | PAR 2 XSlope Location           | Perp  |
| Yes        | Boarding Area Connected to PAR? | Yes   |
| N/A        | Road Slope %                    | 0.2   |
| N/A        | Shelter                         | Yes   |
| No         | Clear Floor Space               | Yes   |
| N/A        | Clear Floor Space Shelter       | Yes   |
| Yes        | Clear Floor Space Width (in)    | 34.0  |
| Yes        | Clear Floor Space Length (in)   | 83.0  |
| Yes        | Clear Floor Space Slope %       | 1.7   |
| No         | Clear Floor Space XSlope %      | 2.6   |
| N/A        | Alcove Condition?               | No    |
| Yes        | Transit Sign?                   | Yes   |
| Yes        | Transit Sign Height (in)        | 94.0  |
| N/A        | Bench?                          | No    |
| No         | Protruding Objects?             | Yes   |

