


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037031	Main Street: S_TRYON_ST	Cross Street: N/A	Location: W
ADA ID: B5044328664C	Overall Compliance: No	Severity Score: 40	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

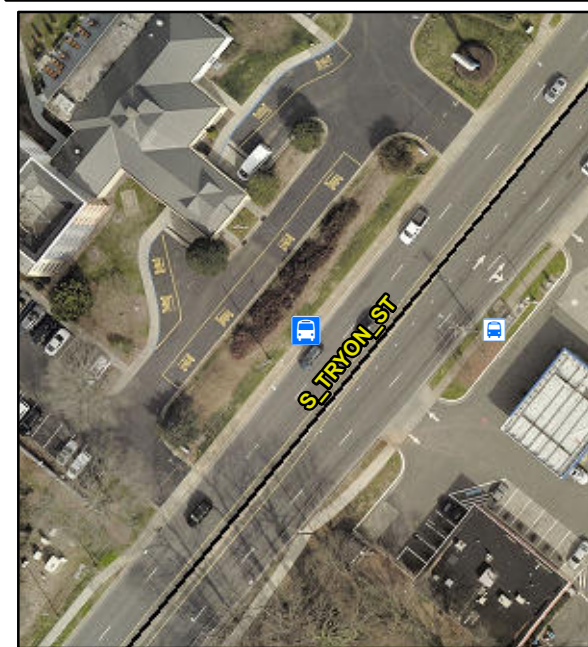

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.3, R302, R302.5,
R308.1.1.1**

CATS Stop ID: **45090**

CATS Stop Description: **Tryon St & Yorkmont Rd**

CATS Route ID: **16, 41x**

CATS Route Name: **Multiple**

Total Cost: \$ **3450.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	66.0
Yes	Boarding Area Slope %	1.5
Yes	Boarding Area XSlope %	0.4
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	0.4
Yes	PAR 1 XSlope %	1.4
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
No	PAR 2 Slope %	2.1
Yes	PAR 2 XSlope %	1.3
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.8
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	92.0
N/A	Bench?	No
No	Protruding Objects?	Yes

