


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 14373	Main Street: EAST_BV	Cross Street: LYNDHURST_AV	Location: SW
ADA ID: B6E8EA6F36FF	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

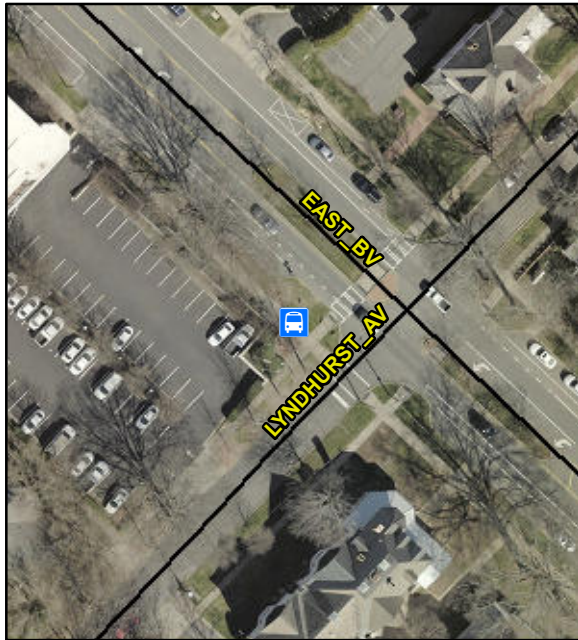

Possible Solutions:

Provide Boarding Area. Provide Sidewalk Connection to Boarding Area. Remove & Replace Clear Floor Space.

Surveyor Notes:

N/A

PROW/ADA:

305.2, 810.2, 810.2.3, 810.3, R302, R308.1.1, R404.1, R404.2

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	N/A
N/A	Boarding Area Length (in)	N/A
N/A	Boarding Area Slope %	N/A
N/A	Boarding Area XSlope %	N/A
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	71.0
Yes	PAR 1 Slope %	0.1
Yes	PAR 1 XSlope %	0.7
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	0.2
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	44.0
Yes	Clear Floor Space Length (in)	57.0
No	Clear Floor Space Slope %	3.4
Yes	Clear Floor Space XSlope %	1.9
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

CATS Stop ID: 08620

CATS Stop Description: East Blvd & Lyndhurst Ave

CATS Route ID: 19

CATS Route Name: Park Road

Total Cost: \$ 1950.00

