


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10011684	Main Street: N_DAVIDSON_ST	Cross Street: E_28TH_ST	Location: E
ADA ID: BCEDEBF5F59B	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

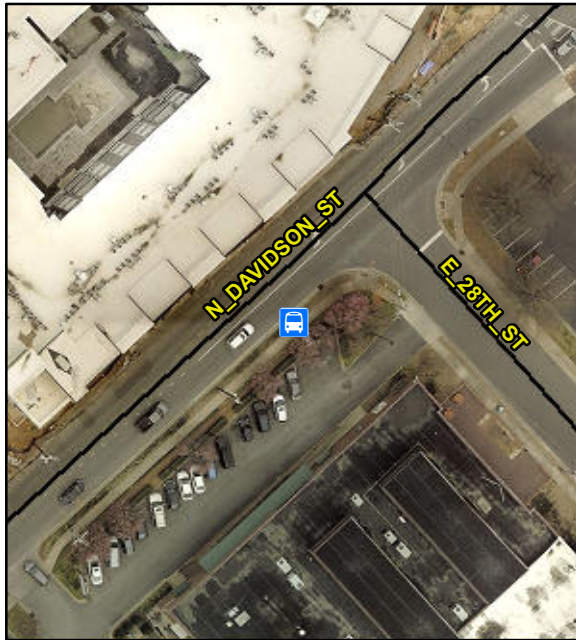

Possible Solutions:

Remove & Replace Boarding Area.

Surveyor Notes:

N/A

PROW/ADA:

**810.2.2, 810.2.4, R308.1.1.1,
R308.1.1.2**

CATS Stop ID: 17550

CATS Stop Description: Davidson St & 28th St

CATS Route ID: 23, 3

CATS Route Name: Multiple

Total Cost: \$ 750.00

Compliance	Description	Data
Yes	Boarding Area	Yes
No	Boarding Area Width (in)	59.0
Yes	Boarding Area Length (in)	114.0
No	Boarding Area Slope %	2.8
Yes	Boarding Area XSlope %	3.7
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	59.0
Yes	PAR 1 Slope %	3.1
Yes	PAR 1 XSlope %	1.6
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	59.0
Yes	PAR 2 Slope %	3.0
Yes	PAR 2 XSlope %	1.4
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	4.9
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	93.0
N/A	Bench?	No
Yes	Protruding Objects?	No

