


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10030277	Main Street: LEAKE_ST	Cross Street: N/A	Location: E
ADA ID: BEA00BEC22BE	Overall Compliance: No	Severity Score: 30	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

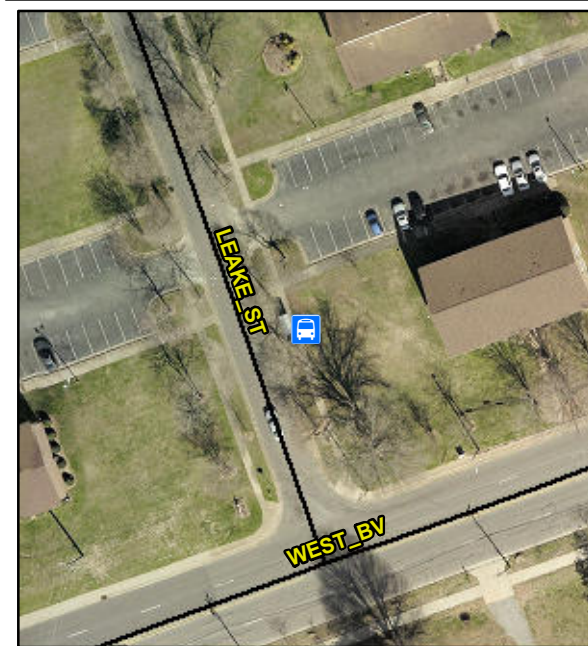

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Remove & Replace
Clear Floor Space. Remove or
Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 402.2, 403.5.1, 810.2.2,
810.2.3, 810.2.4, 810.3, R302, R302.3,
R302.5, R302.6, R308.1.1.1,
R308.1.1.2, R404.1, R404.2**

CATS Stop ID: **14270**
CATS Stop Description: **Leake St & West Blvd**
CATS Route ID: **10**
CATS Route Name: **West Boulevard**

Total Cost: \$ **4650.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	76.0
Yes	Boarding Area Slope %	1.8
No	Boarding Area XSlope %	5.2
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	47.5
No	PAR 1 Slope %	5.6
No	PAR 1 XSlope %	2.3
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
No	PAR 2 Width (in)	47.5
No	PAR 2 Slope %	3.8
Yes	PAR 2 XSlope %	1.5
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.4
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	60.0
Yes	Clear Floor Space Length (in)	67.0
No	Clear Floor Space Slope %	4.3
No	Clear Floor Space XSlope %	3.5
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

