


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10032176	Main Street: MORRIS_FIELD_DR	Cross Street: N/A	Location: W
ADA ID: C8891D51F4CE	Overall Compliance: No	Severity Score: 50	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

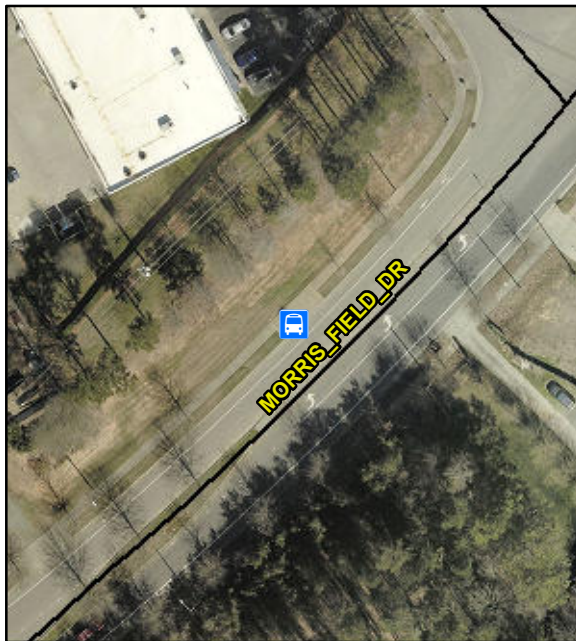

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Provide Clear Floor
Space.**

Surveyor Notes:

**BOARDING AREA MEASURED
WITHIN COMMERCIAL DRIVEWAY**

PROW/ADA:

**402.2, 810.2.3, 810.2.4, 810.3, R302,
R302.6, R308.1.1.2, R404.1**

CATS Stop ID: **16690**
 CATS Stop Description: **Morris Field Dr & Seymour**
 CATS Route ID: **235**
 CATS Route Name: **Goodwill / Amay James**

Total Cost: \$ **1900.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	132.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	6.0
Yes	Boarding Area XSlope %	1.8
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	1.2
Yes	PAR 1 XSlope %	1.8
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	1.3
No	PAR 2 XSlope %	3.4
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	3.3
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	96.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

