


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                        |                                         |             |
|-----------------------------------------|------------------------|-----------------------------------------|-------------|
| Intersection ID: 10016669               | Main Street: CINDY_LN  | Cross Street: BALMAR_PLACE_RD           | Location: N |
| ADA ID: CD2CB21A7C8D                    | Overall Compliance: No | Severity Score: 75                      |             |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |             |

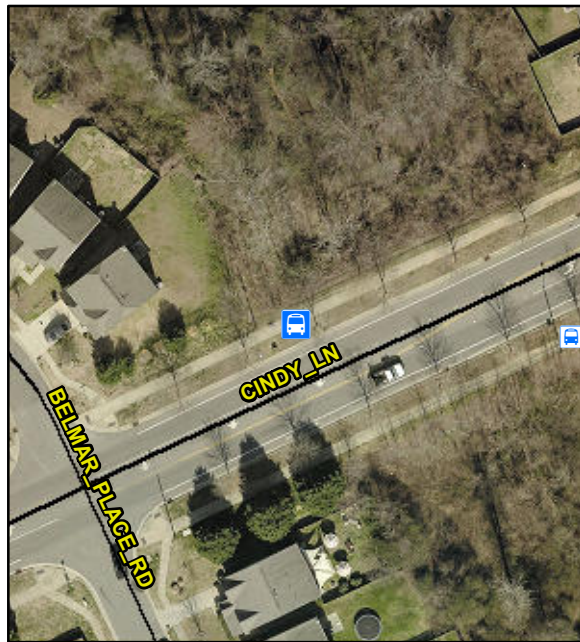

Possible Solutions:

**Provide Boarding Area. Remove & Replace Sidewalk To Boarding Area. Provide Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.**

Surveyor Notes:

**N/A**

PROW/ADA:

**402.2, 810.2, 810.2.3, 810.3, R302, R302.5, R308.1.1, R404.1**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| No         | Boarding Area                   | No   |
| N/A        | Boarding Area Width (in)        | N/A  |
| N/A        | Boarding Area Length (in)       | N/A  |
| N/A        | Boarding Area Slope %           | N/A  |
| N/A        | Boarding Area XSlope %          | N/A  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 72.0 |
| Yes        | PAR 1 Slope %                   | 1.5  |
| No         | PAR 1 XSlope %                  | 2.6  |
| N/A        | PAR 1 XSlope Location           | Perp |
| Yes        | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 72.0 |
| Yes        | PAR 2 Slope %                   | 0.6  |
| Yes        | PAR 2 XSlope %                  | 1.9  |
| N/A        | PAR 2 XSlope Location           | Perp |
| No         | Boarding Area Connected to PAR? | No   |
| N/A        | Road Slope %                    | 1.5  |
| N/A        | Shelter                         | No   |
| No         | Clear Floor Space               | No   |
| N/A        | Clear Floor Space Shelter       | No   |
| N/A        | Clear Floor Space Width (in)    | N/A  |
| N/A        | Clear Floor Space Length (in)   | N/A  |
| N/A        | Clear Floor Space Slope %       | N/A  |
| N/A        | Clear Floor Space XSlope %      | N/A  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 96.0 |
| N/A        | Bench?                          | Yes  |
| No         | Protruding Objects?             | Yes  |

CATS Stop ID: 19531

CATS Stop Description: **Cindy Ln & Belmar Place Rd**

CATS Route ID: 13

CATS Route Name: **Nevin Road**

Total Cost: \$ 3850.00

