


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10028396	Main Street: HIGH_MEADOW_LN	Cross Street: N/A	Location: E
ADA ID: D11B605EC0FD	Overall Compliance: No	Severity Score: 55	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

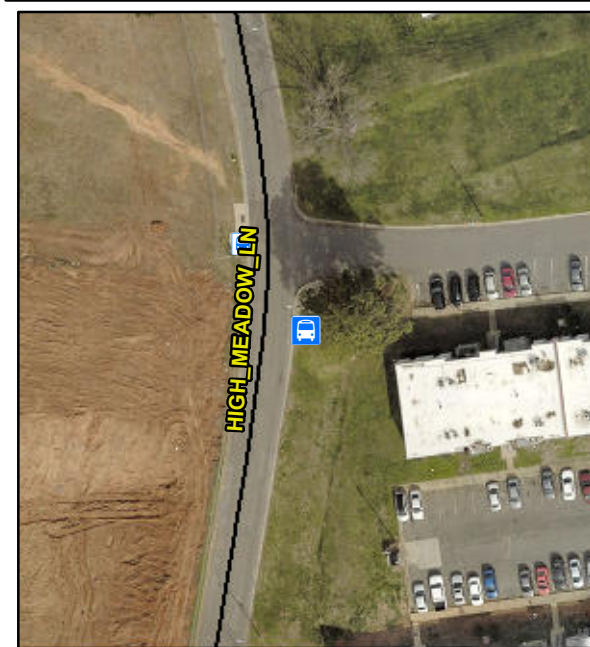

Possible Solutions:

**Remove & Replace Boarding Area.
Provide Sidewalk To Boarding Area.
Provide Clear Floor Space. Remove
or Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.2, 810.2.4, 810.3, R302,
R308.1.1.1, R308.1.1.2, R404.1**

Compliance	Description	Data
Yes	Boarding Area	Yes
No	Boarding Area Width (in)	45.0
Yes	Boarding Area Length (in)	101.0
No	Boarding Area Slope %	3.6
Yes	Boarding Area XSlope %	2.9
No	PAR 1 Exist?	No
N/A	PAR 1 Width (in)	N/A
N/A	PAR 1 Slope %	N/A
N/A	PAR 1 XSlope %	N/A
N/A	PAR 1 XSlope Location	N/A
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
N/A	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.9
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	96.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: **46241**

CATS Stop Description: **High Meadow Ln @ Tree Top Apts**

CATS Route ID: **57**

CATS Route Name: **Archdale**

Total Cost: \$ **3700.00**

