


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10015445	Main Street: N_TRYON_ST	Cross Street: N/A	Location: E
ADA ID: D29EFAD428B6	Overall Compliance: No	Severity Score: 30	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

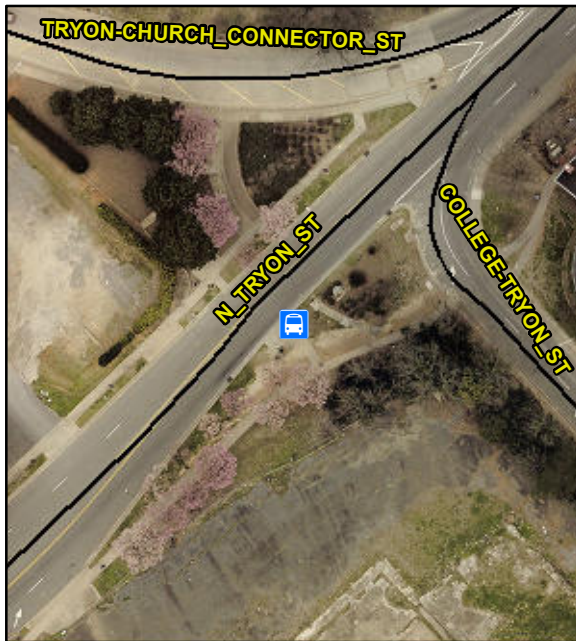

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Clear Floor
Space.**

Surveyor Notes:

N/A

PROW/ADA:

**305.2, 810.2.4, 810.3, R308.1.1.2,
R404.1, R404.2**

CATS Stop ID: **45914**
CATS Stop Description: **Tryon St & 13th St**
CATS Route ID: **11, 21**
CATS Route Name: **Multiple**

Total Cost: \$ **1250.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
Yes	Boarding Area Length (in)	96.0
Yes	Boarding Area Slope %	0.8
No	Boarding Area XSlope %	9.2
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	96.0
Yes	PAR 1 Slope %	7.6
Yes	PAR 1 XSlope %	0.2
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	8.8
N/A	Shelter	No
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	No
Yes	Clear Floor Space Width (in)	70.0
Yes	Clear Floor Space Length (in)	48.0
Yes	Clear Floor Space Slope %	1.3
No	Clear Floor Space XSlope %	10.1
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	93.0
N/A	Bench?	Yes
Yes	Protruding Objects?	No

