


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10014909	Main Street: N_DAVIDSON_ST	Cross Street: E_34TH_ST	Location: N
ADA ID: D37B6B0C6DBD	Overall Compliance: No	Severity Score: 5	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

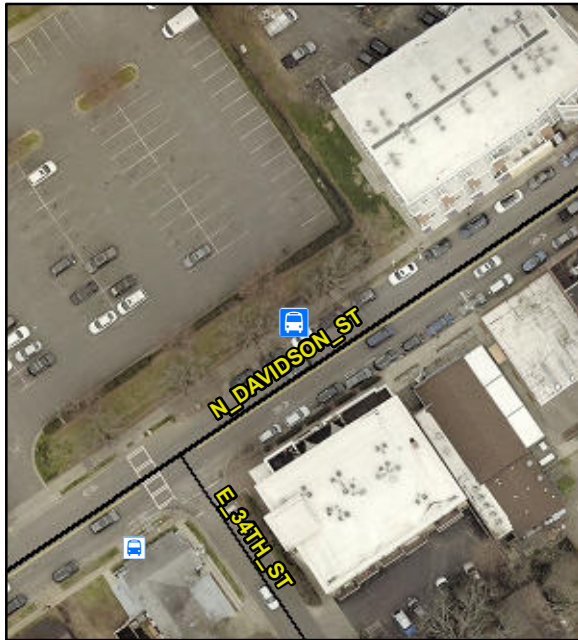

Possible Solutions:

Remove & Replace Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

402.2, 810.2.3, R302, R302.5

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	62.0
Yes	Boarding Area Length (in)	107.0
Yes	Boarding Area Slope %	0.4
Yes	Boarding Area XSlope %	0.3
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	72.0
Yes	PAR 1 Slope %	1.9
No	PAR 1 XSlope %	2.1
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	72.0
Yes	PAR 2 Slope %	0.9
Yes	PAR 2 XSlope %	1.8
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.1
N/A	Shelter	Yes
Yes	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	72.0
Yes	Clear Floor Space Length (in)	64.0
Yes	Clear Floor Space Slope %	1.5
Yes	Clear Floor Space XSlope %	1.7
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 17620

CATS Stop Description: Davidson St & 33rd St

CATS Route ID: 23, 3

CATS Route Name: Multiple

Total Cost: \$ 2700.00

