


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10038367	Main Street: SOUTH_BV	Cross Street: N/A	Location: E
ADA ID: D64509F469A2	Overall Compliance: No	Severity Score: 10	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

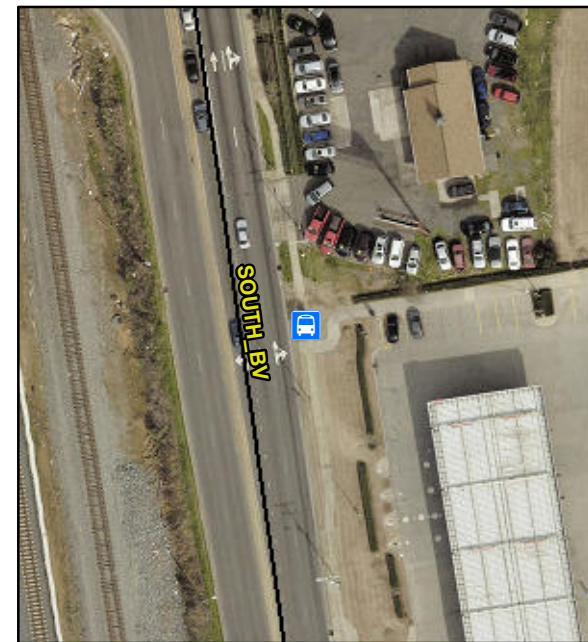

Possible Solutions:

Remove & Replace Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

305.2, 810.3, R404.1, R404.2

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	70.0
Yes	Boarding Area Length (in)	108.0
Yes	Boarding Area Slope %	1.2
Yes	Boarding Area XSlope %	0.2
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	59.0
Yes	PAR 1 Slope %	0.2
Yes	PAR 1 XSlope %	1.2
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	59.0
Yes	PAR 2 Slope %	0.8
Yes	PAR 2 XSlope %	1.5
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	0.3
N/A	Shelter	Yes
No	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	70.0
Yes	Clear Floor Space Length (in)	60.0
No	Clear Floor Space Slope %	2.9
Yes	Clear Floor Space XSlope %	0.2
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	89.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: 30040

CATS Stop Description: South Blvd & Starbrook Dr

CATS Route ID: 12

CATS Route Name: South Boulevard

Total Cost: \$ 2500.00

