


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10037031	Main Street: S_TRYON_ST	Cross Street: N/A	Location: E
ADA ID: D6AD6C536F6F	Overall Compliance: No	Severity Score: 5	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

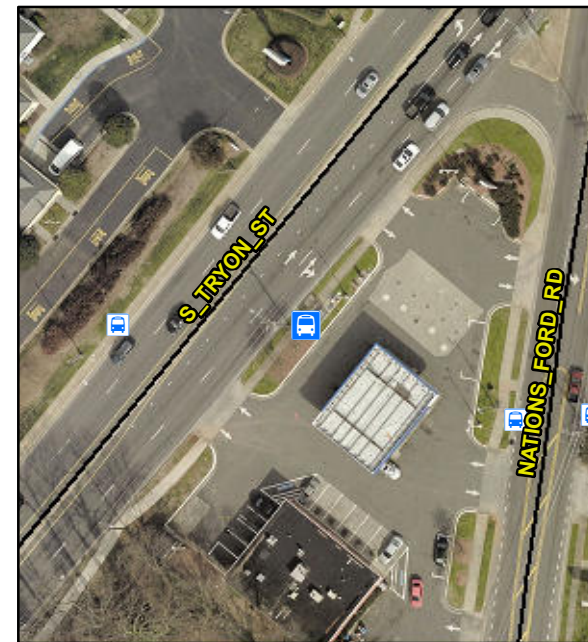

Possible Solutions:

**Remove & Replace Boarding Area.
Remove or Relocate Protruding
Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

810.2.2, R308.1.1.1

CATS Stop ID: **46111**

CATS Stop Description: **Tryon St & Yorkmont Rd**

CATS Route ID: **16, 41x**

CATS Route Name: **Multiple**

Total Cost: \$ **2750.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	72.0
No	Boarding Area Length (in)	35.0
Yes	Boarding Area Slope %	0.3
Yes	Boarding Area XSlope %	2.0
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	0.4
Yes	PAR 1 XSlope %	1.3
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	0.2
Yes	PAR 2 XSlope %	1.7
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.7
N/A	Shelter	Yes
Yes	Clear Floor Space	Yes
N/A	Clear Floor Space Shelter	Yes
Yes	Clear Floor Space Width (in)	50.0
Yes	Clear Floor Space Length (in)	65.0
Yes	Clear Floor Space Slope %	1.6
Yes	Clear Floor Space XSlope %	0.6
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	97.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

