


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                           |                          |                    |              |
|---------------------------|--------------------------|--------------------|--------------|
| Intersection ID: 10035443 | Main Street: RANDOLPH_RD | Cross Street: N/A  | Location: NE |
| ADA ID: D8D9FC894F55      | Overall Compliance: No   | Severity Score: 45 |              |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

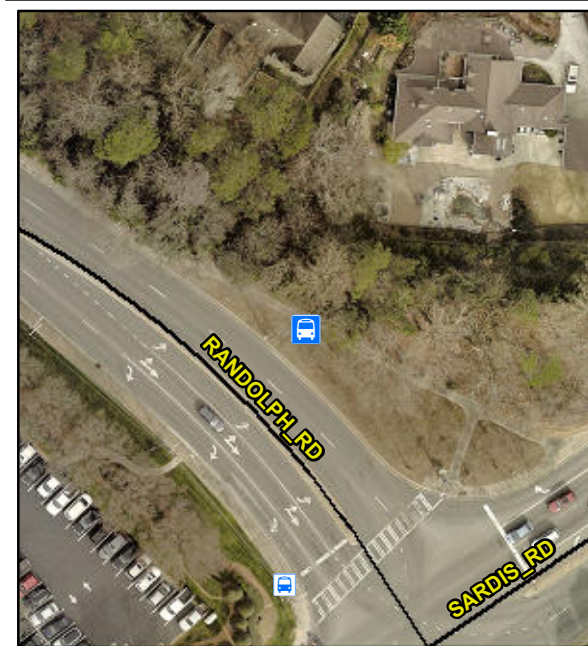

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove & Replace  
Clear Floor Space.**

Surveyor Notes:

**N/A**

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,  
810.2.4, 810.3, R302, R302.6,  
R308.1.1.1, R308.1.1.2, R404.1,  
R404.2**

CATS Stop ID: **24190**

CATS Stop Description: **Randolph Rd & Sardis Rd**

CATS Route ID: **62x**

CATS Route Name: **Rea Road Express**

Total Cost: **\$ 1950.00**

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| No         | Boarding Area Width (in)        | 45.0 |
| Yes        | Boarding Area Length (in)       | 96.0 |
| No         | Boarding Area Slope %           | 4.2  |
| No         | Boarding Area XSlope %          | 9.3  |
| Yes        | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 59.5 |
| Yes        | PAR 1 Slope %                   | 6.6  |
| Yes        | PAR 1 XSlope %                  | 0.7  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 59.5 |
| Yes        | PAR 2 Slope %                   | 7.1  |
| No         | PAR 2 XSlope %                  | 3.3  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 8.5  |
| N/A        | Shelter                         | Yes  |
| No         | Clear Floor Space               | Yes  |
| N/A        | Clear Floor Space Shelter       | Yes  |
| Yes        | Clear Floor Space Width (in)    | 65.5 |
| Yes        | Clear Floor Space Length (in)   | 64.0 |
| No         | Clear Floor Space Slope %       | 5.1  |
| No         | Clear Floor Space XSlope %      | 9.6  |
| N/A        | Alcove Condition?               | No   |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 90.0 |
| N/A        | Bench?                          | Yes  |
| Yes        | Protruding Objects?             | No   |

