


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10031170	Main Street: MARION_DIEHL_PARK_DR	Cross Street: N/A	Location: E
ADA ID: DCAB2D661AD6	Overall Compliance: No	Severity Score: 70	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

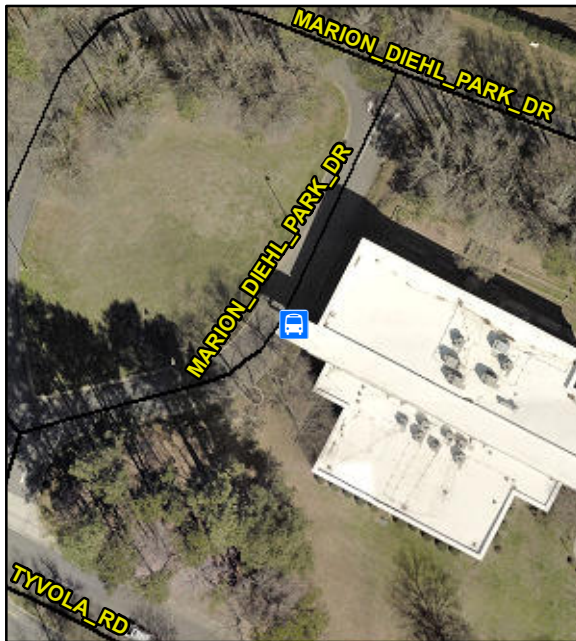

Possible Solutions:

**Remove & Replace Boarding Area.
Provide Sidewalk To Boarding Area.
Adjust Transit Stop Sign Height.**

Surveyor Notes:

**TRANSIT STOP LOCATED IN
BUILDING ENTRANCE, NO CATS ID
LISTED**

PROW/ADA:

**302.7, 402.2, 810.2.4, R302,
R308.1.1.2, R402.3**

CATS Stop ID: **32990**
CATS Stop Description: **Marion Diehl**
CATS Route ID: **60**
CATS Route Name: **Tyvola Road**

Total Cost: \$ **1450.00**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	131.0
Yes	Boarding Area Length (in)	118.0
No	Boarding Area Slope %	9.0
Yes	Boarding Area XSlope %	0.2
No	PAR 1 Exist?	No
N/A	PAR 1 Width (in)	N/A
N/A	PAR 1 Slope %	N/A
N/A	PAR 1 XSlope %	N/A
N/A	PAR 1 XSlope Location	N/A
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
N/A	Boarding Area Connected to PAR?	No
N/A	Road Slope %	1.9
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
No	Transit Sign Height (in)	47.0
N/A	Bench?	No
Yes	Protruding Objects?	No

