


# Access Compliance Report Public Rights-of-Way (Transit Stops)

|                                         |                        |                                         |              |
|-----------------------------------------|------------------------|-----------------------------------------|--------------|
| Intersection ID: 10033962               | Main Street: PARK_RD   | Cross Street: N/A                       | Location: SE |
| ADA ID: DE3CF33EF1F3                    | Overall Compliance: No | Severity Score: 15                      |              |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |              |

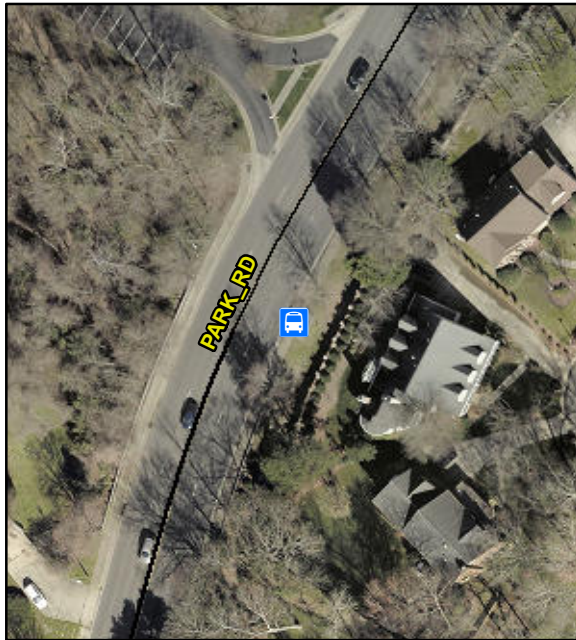

Possible Solutions:

**Remove & Replace Boarding Area.  
Remove & Replace Sidewalk To  
Boarding Area. Remove & Replace  
Clear Floor Space. Remove or  
Relocate Protruding  
Objects/Obstructions.**

Surveyor Notes:

**N/A**

PROW/ADA:

**305.2, 402.2, 810.2.2, 810.2.3,  
810.2.4, 810.3, R302, R302.5, R302.6,  
R308.1.1.1, R308.1.1.2, R404.1,  
R404.2**

CATS Stop ID: 21090

CATS Stop Description: Park Rd & Northampton Dr

CATS Route ID: 19

CATS Route Name: Park Road

Total Cost: \$ 4650.00

| Compliance | Description                     | Data |
|------------|---------------------------------|------|
| Yes        | Boarding Area                   | Yes  |
| Yes        | Boarding Area Width (in)        | 62.0 |
| No         | Boarding Area Length (in)       | 82.0 |
| No         | Boarding Area Slope %           | 3.8  |
| Yes        | Boarding Area XSlope %          | 2.0  |
| No         | PAR 1 Exist?                    | Yes  |
| Yes        | PAR 1 Width (in)                | 60.0 |
| Yes        | PAR 1 Slope %                   | 1.8  |
| No         | PAR 1 XSlope %                  | 3.9  |
| N/A        | PAR 1 XSlope Location           | Perp |
| No         | PAR 2 Exist?                    | Yes  |
| Yes        | PAR 2 Width (in)                | 60.0 |
| Yes        | PAR 2 Slope %                   | 1.5  |
| No         | PAR 2 XSlope %                  | 3.1  |
| N/A        | PAR 2 XSlope Location           | Perp |
| Yes        | Boarding Area Connected to PAR? | Yes  |
| N/A        | Road Slope %                    | 3.4  |
| N/A        | Shelter                         | Yes  |
| No         | Clear Floor Space               | Yes  |
| N/A        | Clear Floor Space Shelter       | Yes  |
| Yes        | Clear Floor Space Width (in)    | 45.0 |
| Yes        | Clear Floor Space Length (in)   | 62.0 |
| No         | Clear Floor Space Slope %       | 3.1  |
| Yes        | Clear Floor Space XSlope %      | 1.8  |
| N/A        | Alcove Condition?               | Yes  |
| Yes        | Transit Sign?                   | Yes  |
| Yes        | Transit Sign Height (in)        | 96.0 |
| N/A        | Bench?                          | Yes  |
| No         | Protruding Objects?             | Yes  |

