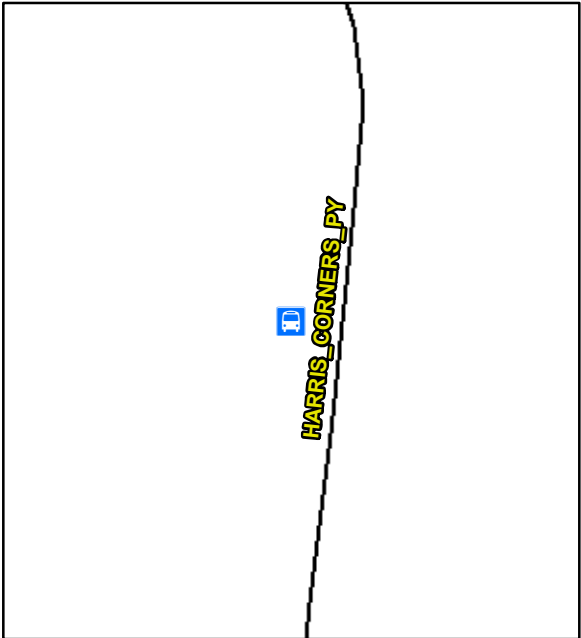


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 10015275	Main Street: HARRIS_CORNERS_PY	Cross Street: N/A	Location: W
ADA ID: E86086212AC0	Overall Compliance: No	Severity Score: 15	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

	Possible Solutions: Remove & Replace Boarding Area. Remove & Replace Sidewalk To Boarding Area. Remove or Relocate Protruding Objects/Obstructions. Surveyor Notes: N/A PROW/ADA: 402.2, 810.2.2, 810.2.3, 810.2.4, R302, R302.5, R302.6, R308.1.1.1, R308.1.1.2	<table> <tr> <th>Compliance</th><th>Description</th><th>Data</th></tr> <tr><td>Yes</td><td>Boarding Area</td><td>Yes</td></tr> <tr><td>No</td><td>Boarding Area Width (in)</td><td>48.0</td></tr> <tr><td>Yes</td><td>Boarding Area Length (in)</td><td>105.0</td></tr> <tr><td>No</td><td>Boarding Area Slope %</td><td>3.4</td></tr> <tr><td>Yes</td><td>Boarding Area XSlope %</td><td>0.7</td></tr> <tr><td>No</td><td>PAR 1 Exist?</td><td>Yes</td></tr> <tr><td>Yes</td><td>PAR 1 Width (in)</td><td>48.0</td></tr> <tr><td>Yes</td><td>PAR 1 Slope %</td><td>0.7</td></tr> <tr><td>No</td><td>PAR 1 XSlope %</td><td>3.4</td></tr> <tr><td>N/A</td><td>PAR 1 XSlope Location</td><td>Perp</td></tr> <tr><td>No</td><td>PAR 2 Exist?</td><td>Yes</td></tr> <tr><td>Yes</td><td>PAR 2 Width (in)</td><td>48.0</td></tr> <tr><td>Yes</td><td>PAR 2 Slope %</td><td>0.3</td></tr> <tr><td>No</td><td>PAR 2 XSlope %</td><td>3.0</td></tr> <tr><td>N/A</td><td>PAR 2 XSlope Location</td><td>Perp</td></tr> <tr><td>Yes</td><td>Boarding Area Connected to PAR?</td><td>Yes</td></tr> <tr><td>N/A</td><td>Road Slope %</td><td>0.7</td></tr> <tr><td>N/A</td><td>Shelter</td><td>Yes</td></tr> <tr><td>Yes</td><td>Clear Floor Space</td><td>Yes</td></tr> <tr><td>N/A</td><td>Clear Floor Space Shelter</td><td>Yes</td></tr> <tr><td>Yes</td><td>Clear Floor Space Width (in)</td><td>48.0</td></tr> <tr><td>Yes</td><td>Clear Floor Space Length (in)</td><td>67.0</td></tr> <tr><td>Yes</td><td>Clear Floor Space Slope %</td><td>2.0</td></tr> <tr><td>Yes</td><td>Clear Floor Space XSlope %</td><td>1.4</td></tr> <tr><td>N/A</td><td>Alcove Condition?</td><td>No</td></tr> <tr><td>Yes</td><td>Transit Sign?</td><td>Yes</td></tr> <tr><td>Yes</td><td>Transit Sign Height (in)</td><td>95.0</td></tr> <tr><td>N/A</td><td>Bench?</td><td>Yes</td></tr> <tr><td>No</td><td>Protruding Objects?</td><td>Yes</td></tr> </table>	Compliance	Description	Data	Yes	Boarding Area	Yes	No	Boarding Area Width (in)	48.0	Yes	Boarding Area Length (in)	105.0	No	Boarding Area Slope %	3.4	Yes	Boarding Area XSlope %	0.7	No	PAR 1 Exist?	Yes	Yes	PAR 1 Width (in)	48.0	Yes	PAR 1 Slope %	0.7	No	PAR 1 XSlope %	3.4	N/A	PAR 1 XSlope Location	Perp	No	PAR 2 Exist?	Yes	Yes	PAR 2 Width (in)	48.0	Yes	PAR 2 Slope %	0.3	No	PAR 2 XSlope %	3.0	N/A	PAR 2 XSlope Location	Perp	Yes	Boarding Area Connected to PAR?	Yes	N/A	Road Slope %	0.7	N/A	Shelter	Yes	Yes	Clear Floor Space	Yes	N/A	Clear Floor Space Shelter	Yes	Yes	Clear Floor Space Width (in)	48.0	Yes	Clear Floor Space Length (in)	67.0	Yes	Clear Floor Space Slope %	2.0	Yes	Clear Floor Space XSlope %	1.4	N/A	Alcove Condition?	No	Yes	Transit Sign?	Yes	Yes	Transit Sign Height (in)	95.0	N/A	Bench?	Yes	No	Protruding Objects?	Yes
Compliance	Description	Data																																																																																										
Yes	Boarding Area	Yes																																																																																										
No	Boarding Area Width (in)	48.0																																																																																										
Yes	Boarding Area Length (in)	105.0																																																																																										
No	Boarding Area Slope %	3.4																																																																																										
Yes	Boarding Area XSlope %	0.7																																																																																										
No	PAR 1 Exist?	Yes																																																																																										
Yes	PAR 1 Width (in)	48.0																																																																																										
Yes	PAR 1 Slope %	0.7																																																																																										
No	PAR 1 XSlope %	3.4																																																																																										
N/A	PAR 1 XSlope Location	Perp																																																																																										
No	PAR 2 Exist?	Yes																																																																																										
Yes	PAR 2 Width (in)	48.0																																																																																										
Yes	PAR 2 Slope %	0.3																																																																																										
No	PAR 2 XSlope %	3.0																																																																																										
N/A	PAR 2 XSlope Location	Perp																																																																																										
Yes	Boarding Area Connected to PAR?	Yes																																																																																										
N/A	Road Slope %	0.7																																																																																										
N/A	Shelter	Yes																																																																																										
Yes	Clear Floor Space	Yes																																																																																										
N/A	Clear Floor Space Shelter	Yes																																																																																										
Yes	Clear Floor Space Width (in)	48.0																																																																																										
Yes	Clear Floor Space Length (in)	67.0																																																																																										
Yes	Clear Floor Space Slope %	2.0																																																																																										
Yes	Clear Floor Space XSlope %	1.4																																																																																										
N/A	Alcove Condition?	No																																																																																										
Yes	Transit Sign?	Yes																																																																																										
Yes	Transit Sign Height (in)	95.0																																																																																										
N/A	Bench?	Yes																																																																																										
No	Protruding Objects?	Yes																																																																																										

CATS Stop ID: 46412

CATS Stop Description: Harris Corners Pkwy & Maple View Ln

CATS Route ID: 7

CATS Route Name: Beatties Ford

Total Cost: \$ 4150.00

