


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 10040526	Main Street: W_5TH_ST	Cross Street: N_CEDAR_ST	Location: N
ADA ID: E88E8AC500CF	Overall Compliance: No	Severity Score: 55	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

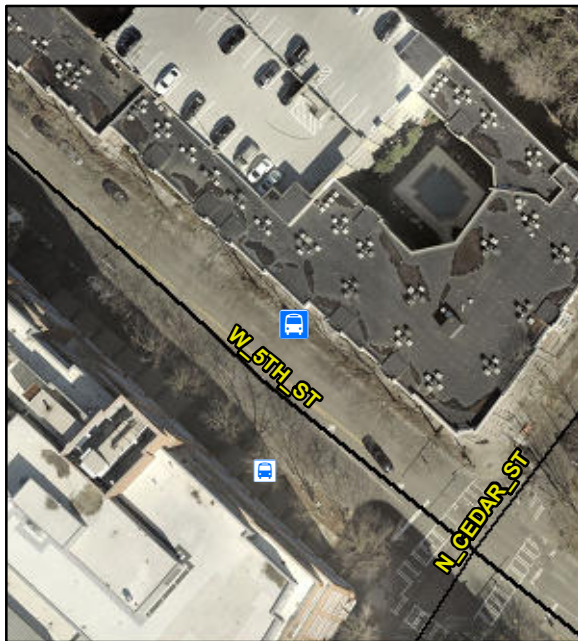

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 810.2.3, 810.2.4, R302, R302.5,
R302.6, R308.1.1.2**

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	84.0
Yes	Boarding Area Length (in)	96.0
No	Boarding Area Slope %	6.6
Yes	Boarding Area XSlope %	0.9
No	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	64.0
No	PAR 1 Slope %	3.1
No	PAR 1 XSlope %	2.1
N/A	PAR 1 XSlope Location	Perp
No	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	64.0
No	PAR 2 Slope %	2.5
Yes	PAR 2 XSlope %	0.2
N/A	PAR 2 XSlope Location	Perp
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	1.2
N/A	Shelter	No
N/A	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	94.0
N/A	Bench?	No
Yes	Protruding Objects?	No

CATS Stop ID: 21511

CATS Stop Description: 5th St & Cedar St

CATS Route ID: 1, 7

CATS Route Name: Multiple

Total Cost: \$ 2150.00

