


Access Compliance Report Public Rights-of-Way (Transit Stops)

Intersection ID: 8312	Main Street: HOVIS_RD	Cross Street: PONDEROSA_ST	Location: S
ADA ID: E8D9B61FF20C	Overall Compliance: No	Severity Score: 50	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

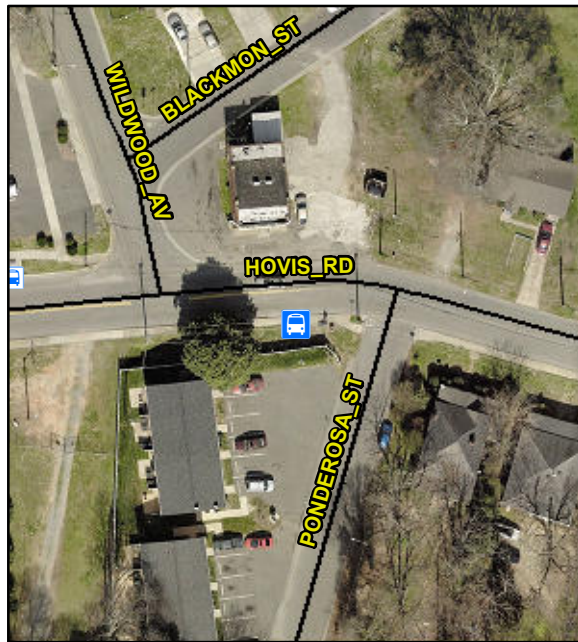

Possible Solutions:

**Remove & Replace Boarding Area.
Remove & Replace Sidewalk To
Boarding Area. Provide Clear Floor
Space. Remove or Relocate
Protruding Objects/Obstructions.**

Surveyor Notes:

N/A

PROW/ADA:

**402.2, 403.5.1, 810.2.2, 810.2.3,
810.2.4, 810.3, R302, R302.3, R302.5,
R302.6, R308.1.1.1, R308.1.1.2,
R404.1**

CATS Stop ID: 12250

CATS Stop Description: **Hovis Rd & Wildwood Ave**

CATS Route ID: 18, 2

CATS Route Name: **Multiple**

Total Cost: \$ 3900.00

Compliance	Description	Data
Yes	Boarding Area	Yes
Yes	Boarding Area Width (in)	60.0
No	Boarding Area Length (in)	50.0
No	Boarding Area Slope %	3.0
No	Boarding Area XSlope %	3.8
No	PAR 1 Exist?	Yes
No	PAR 1 Width (in)	38.0
No	PAR 1 Slope %	3.8
No	PAR 1 XSlope %	3.0
N/A	PAR 1 XSlope Location	Perp
N/A	PAR 2 Exist?	No
N/A	PAR 2 Width (in)	N/A
N/A	PAR 2 Slope %	N/A
N/A	PAR 2 XSlope %	N/A
N/A	PAR 2 XSlope Location	N/A
Yes	Boarding Area Connected to PAR?	Yes
N/A	Road Slope %	2.8
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	93.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

