


Access Compliance Report

Public Rights-of-Way

(Transit Stops)

Intersection ID: 19071	Main Street: S_TRYON_ST	Cross Street: LAND_GRANT_RD	Location: S
ADA ID: F3BAD6B44BB7	Overall Compliance: No	Severity Score: 75	
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

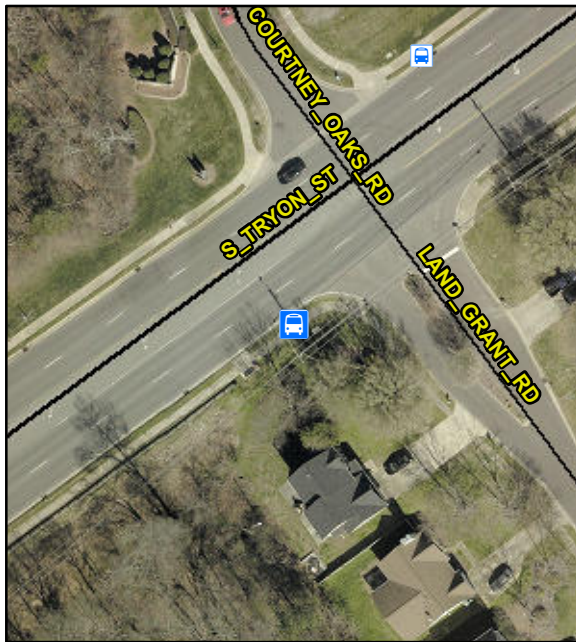

Possible Solutions:

Provide Boarding Area. Provide Sidewalk Connection to Boarding Area. Provide Clear Floor Space. Remove or Relocate Protruding Objects/Obstructions.

Surveyor Notes:

N/A

PROW/ADA:

810.2, 810.2.3, 810.3, R302, R308.1.1, R404.1

Compliance	Description	Data
No	Boarding Area	No
N/A	Boarding Area Width (in)	120.0
N/A	Boarding Area Length (in)	96.0
N/A	Boarding Area Slope %	1.3
N/A	Boarding Area XSlope %	0.4
Yes	PAR 1 Exist?	Yes
Yes	PAR 1 Width (in)	60.0
Yes	PAR 1 Slope %	1.3
Yes	PAR 1 XSlope %	0.9
N/A	PAR 1 XSlope Location	Perp
Yes	PAR 2 Exist?	Yes
Yes	PAR 2 Width (in)	60.0
Yes	PAR 2 Slope %	1.0
Yes	PAR 2 XSlope %	1.0
N/A	PAR 2 XSlope Location	Perp
No	Boarding Area Connected to PAR?	No
N/A	Road Slope %	0.7
N/A	Shelter	No
No	Clear Floor Space	No
N/A	Clear Floor Space Shelter	No
N/A	Clear Floor Space Width (in)	N/A
N/A	Clear Floor Space Length (in)	N/A
N/A	Clear Floor Space Slope %	N/A
N/A	Clear Floor Space XSlope %	N/A
N/A	Alcove Condition?	No
Yes	Transit Sign?	Yes
Yes	Transit Sign Height (in)	95.0
N/A	Bench?	Yes
No	Protruding Objects?	Yes

CATS Stop ID: **46172**

CATS Stop Description: **Tryon St & Land Grant Rd**

CATS Route ID: **16, 41x**

CATS Route Name: **Multiple**

Total Cost: \$ **3900.00**

