


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: 10022318	Main Street: CAMDEN_RD	Location:	N/A
ADA ID: 06836CE4DF5E	ParkingType: ParaPark	Overall Compliance: No	Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

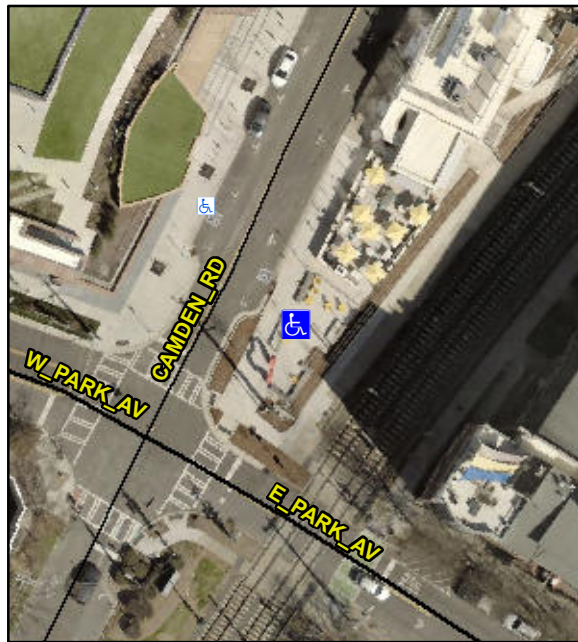

Possible Solutions:

Advise relocating to an area with maximum 2% slopes


Surveyor Notes:

N/A

PROW/ADA:

TBD

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	120.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	0.0	N/A	Access Aisle Width (in)	N/A
Yes	Adjacent Sidewalk XSlope (%)	0.3	N/A	Access Aisle Length (in)	N/A
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)		79.0	
	N/A	Parking Spot Length (in)		319.0	
	N/A	Van Accessible?		N/A	
	No	Curb Ramp?		No	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

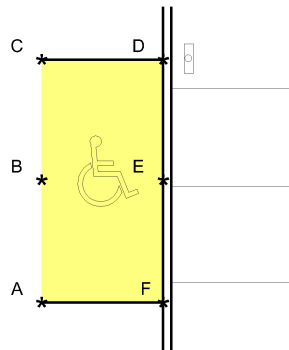

Total Cost: \$ \$0.00

N/A	Parking Space/Access Aisle Slopes (%)						
C Slope (%)	0.9	D Slope (%)	0.7	I Slope (%)	N/A	L Slope (%)	N/A
B Slope (%)	0.9	E Slope (%)	0.8	H Slope (%)	N/A	K Slope (%)	N/A
A Slope (%)	1.3	F Slope (%)	0.1	G Slope (%)	N/A	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)						
C XSlope (%)	3.8	D XSlope (%)	5.1	I XSlope (%)	N/A	L XSlope (%)	N/A
B XSlope (%)	3.8	E XSlope (%)	4.2	H XSlope (%)	N/A	K XSlope (%)	N/A
A XSlope (%)	2.7	F XSlope (%)	2.9	G XSlope (%)	N/A	J XSlope (%)	N/A

