


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: N/A	Main Street: E 5TH ST	Location: N/A
ADA ID: 0CE1E5906CDD	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

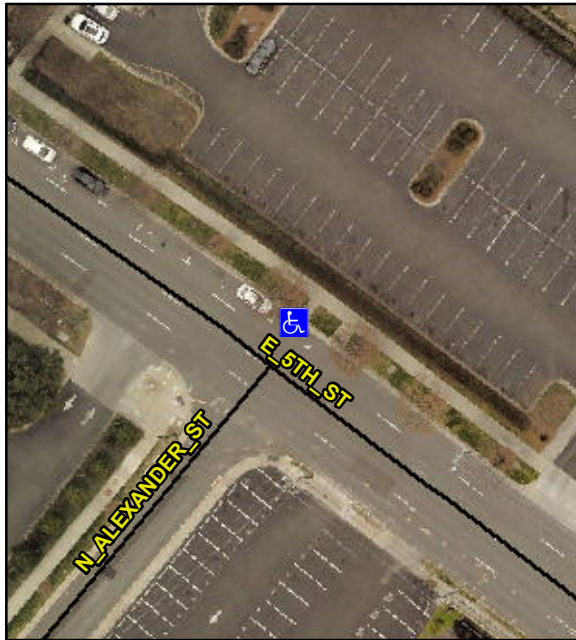

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

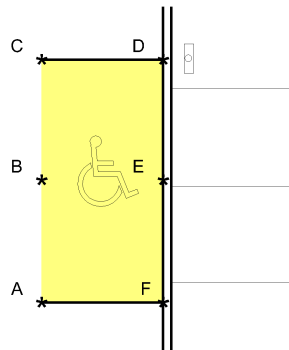

Total Cost: \$ \$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	No	Accessible Route?	No
Yes	Adjacent Sidewalk Width (in)	72.0	No	Access Aisle Marking?	No
Yes	Adjacent Sidewalk Slope (%)	1.4	N/A	Access Aisle Width (in)	N/A
No	Adjacent Sidewalk XSlope (%)	3.3	N/A	Access Aisle Length (in)	N/A
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)		92.0	
	N/A	Parking Spot Length (in)		209.5	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
	C Slope (%)	2.3	D Slope (%)	2.0	I Slope (%)	N/A
	B Slope (%)	2.2	E Slope (%)	3.2	H Slope (%)	N/A
	A Slope (%)	2.5	F Slope (%)	2.3	G Slope (%)	N/A
					J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)					
	C XSlope (%)	3.2	D XSlope (%)	4.0	I XSlope (%)	N/A
	B XSlope (%)	2.0	E XSlope (%)	1.0	H XSlope (%)	N/A
	A XSlope (%)	3.0	F XSlope (%)	4.0	G XSlope (%)	N/A
					J XSlope (%)	N/A

