


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: OLD PINEVILLE RD	Location: N/A
ADA ID: 17861F20B106	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

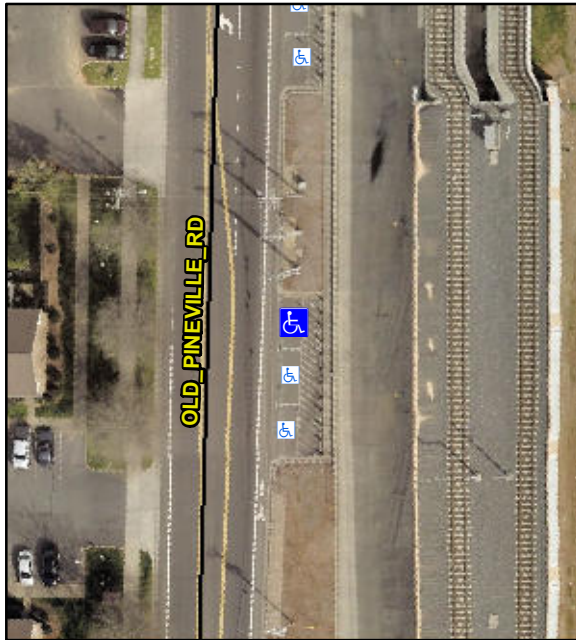

Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

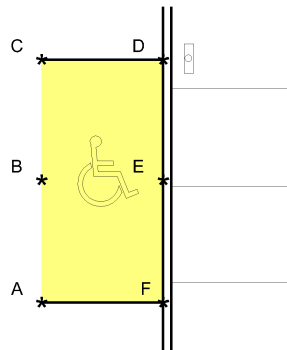

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	No	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	48.0	No	Access Aisle Marking?	Yes
No	Adjacent Sidewalk Slope (%)	2.2	Yes	Access Aisle Width (in)	79.0
Yes	Adjacent Sidewalk XSlope (%)	1.3	No	Access Aisle Length (in)	237.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		104.0	
	N/A	Parking Spot Length (in)		237.0	
	N/A	Van Accessible?		N/A	
	No	Curb Ramp?		No	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)							
C Slope (%)	1.3	D Slope (%)	3.7	I Slope (%)	N/A	L Slope (%)	N/A	
B Slope (%)	2.3	E Slope (%)	2.9	H Slope (%)	N/A	K Slope (%)	N/A	
A Slope (%)	1.6	F Slope (%)	2.8	G Slope (%)	N/A	J Slope (%)	N/A	
N/A	Parking Space/Access Aisle XSlopes (%)							
C XSlope (%)	1.0	D XSlope (%)	1.9	I XSlope (%)	N/A	L XSlope (%)	N/A	
B XSlope (%)	1.8	E XSlope (%)	2.5	H XSlope (%)	N/A	K XSlope (%)	N/A	
A XSlope (%)	1.7	F XSlope (%)	2.2	G XSlope (%)	N/A	J XSlope (%)	N/A	

