

Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID:	N/A	Main Street: COMMONWEALTH AV				Location:	OnStreet
ADA ID:	1FD007EC4CDB	ParkingType:	AngParkAART	Overall Compliance:	No	Severity Score:	0.0
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance			



Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

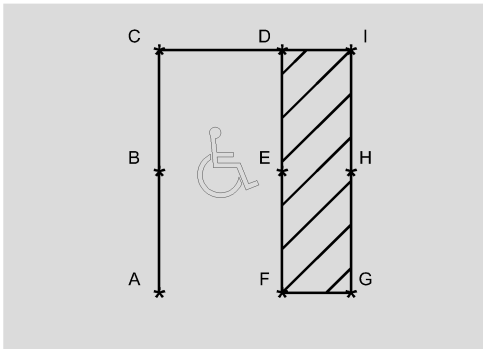

Total Cost:

\$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	118.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	2.0	No	Access Aisle Width (in)	70.0
No	Adjacent Sidewalk XSlope (%)	2.9	No	Access Aisle Length (in)	133.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
	No	Parking Spot Width (in)		110.0	
	No	Parking Spot Length (in)		248.0	
	N/A	Van Accessible?		No	
	Yes	Curb Ramp?		Yes	
	No	Identification Sign?		Yes	
	N/A	Sign Height (in)		102.0	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		No	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		No	
	N/A	Meter Clear Space?		No	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		No	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		No	
	N/A	Meter Parallel Reach (in)		N/A	

No Parking Space/Access Aisle Slopes (%)

C Slope (%)	2.9	D Slope (%)	4.6	I Slope (%)	N/A	L Slope (%)	N/A
B Slope (%)	2.4	E Slope (%)	2.3	H Slope (%)	2.1	K Slope (%)	N/A
A Slope (%)	2.7	F Slope (%)	2.6	G Slope (%)	3.0	J Slope (%)	N/A

No Parking Space/Access Aisle XSlopes (%)

C XSlope (%)	0.3	D XSlope (%)	2.9	I XSlope (%)	N/A	L XSlope (%)	N/A
B XSlope (%)	2.9	E XSlope (%)	0.6	H XSlope (%)	1.7	K XSlope (%)	N/A
A XSlope (%)	1.8	F XSlope (%)	1.4	G XSlope (%)	3.4	J XSlope (%)	N/A

