


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: W 9TH ST	Location: N/A
ADA ID: 29EDA9107C59	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

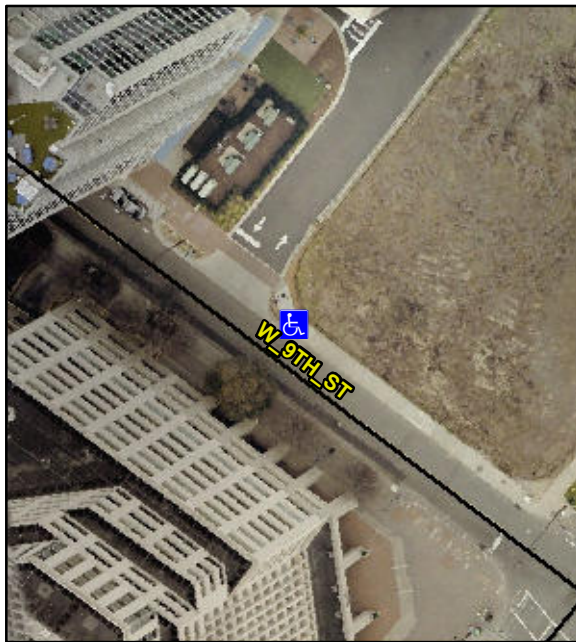

Possible Solutions:

**Advise relocating to an area with maximum 2% slopes**


Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	130.0	N/A	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	1.4	Yes	Access Aisle Width (in)	84.0
Yes	Adjacent Sidewalk XSlope (%)	0.6	No	Access Aisle Length (in)	270.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		77.0	
	N/A	Parking Spot Length (in)		260.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

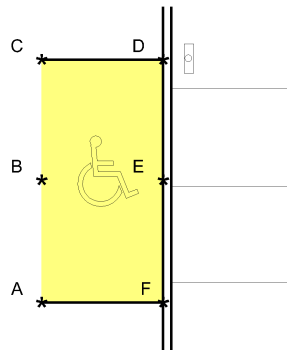

Total Cost: \$ \$0.00

N/A	Parking Space/Access Aisle Slopes (%)					
C Slope (%)	0.4	D Slope (%)	1.0	I Slope (%)	N/A	L Slope (%)
B Slope (%)	0.5	E Slope (%)	0.7	H Slope (%)	N/A	K Slope (%)
A Slope (%)	4.8	F Slope (%)	5.9	G Slope (%)	N/A	J Slope (%)
N/A	Parking Space/Access Aisle XSlopes (%)					
C XSlope (%)	2.7	D XSlope (%)	2.7	I XSlope (%)	N/A	L XSlope (%)
B XSlope (%)	2.2	E XSlope (%)	0.2	H XSlope (%)	N/A	K XSlope (%)
A XSlope (%)	2.8	F XSlope (%)	1.4	G XSlope (%)	N/A	J XSlope (%)

