

Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: N/A	Main Street: W 5TH ST	Location: N/A
ADA ID: 2D4F88785E5E	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance



Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

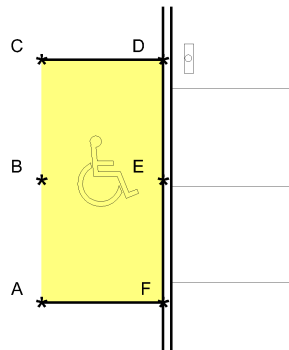

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	72.0	No	Access Aisle Marking?	No
No	Adjacent Sidewalk Slope (%)	5.7	N/A	Access Aisle Width (in)	60.0
Yes	Adjacent Sidewalk XSlope (%)	1.4	N/A	Access Aisle Length (in)	132.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)		92.0	
	N/A	Parking Spot Length (in)		212.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)						
C Slope (%)	4.9	D Slope (%)	4.9	I Slope (%)	N/A	L Slope (%)	N/A
B Slope (%)	4.8	E Slope (%)	6.6	H Slope (%)	N/A	K Slope (%)	N/A
A Slope (%)	4.6	F Slope (%)	5.5	G Slope (%)	N/A	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)						
C XSlope (%)	3.5	D XSlope (%)	0.9	I XSlope (%)	N/A	L XSlope (%)	N/A
B XSlope (%)	3.6	E XSlope (%)	2.1	H XSlope (%)	N/A	K XSlope (%)	N/A
A XSlope (%)	3.2	F XSlope (%)	2.1	G XSlope (%)	N/A	J XSlope (%)	N/A

