



# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)



Intersection ID:	N/A	Main Street: COMMONWEALTH AV	Location:	OnStreet
ADA ID:	331431A05543	ParkingType:	AngParkAALT	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 0.0	
			Field Measurements/Component Compliance	



Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

N/A

PROW/ADA:

TBD

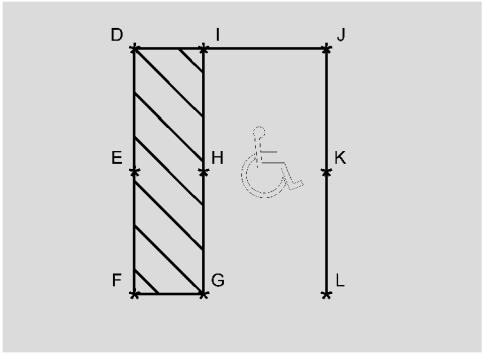

Total Cost: \$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	120.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	0.2	No	Access Aisle Width (in)	63.0
No	Adjacent Sidewalk XSlope (%)	2.7	No	Access Aisle Length (in)	249.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
	No	Parking Spot Width (in)		108.0	
	No	Parking Spot Length (in)		249.0	
	N/A	Van Accessible?		No	
	Yes	Curb Ramp?		Yes	
	No	Identification Sign?		Yes	
	N/A	Sign Height (in)		76.0	
	No	Vertical Clearance		N/A	
	N/A	Parking Meter?		No	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		No	
	N/A	Meter Clear Space?		No	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		No	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		No	
	N/A	Meter Parallel Reach (in)		N/A	

Yes	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	N/A	D Slope (%)	0.1	I Slope (%)	0.2	L Slope (%)	1.7
	B Slope (%)	N/A	E Slope (%)	2.6	H Slope (%)	1.4	K Slope (%)	1.4
	A Slope (%)	N/A	F Slope (%)	3.1	G Slope (%)	3.5	J Slope (%)	0.5
No	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	N/A	D XSlope (%)	3.1	I XSlope (%)	4.3	L XSlope (%)	2.9
	B XSlope (%)	N/A	E XSlope (%)	0.7	H XSlope (%)	0.9	K XSlope (%)	4.0
	A XSlope (%)	N/A	F XSlope (%)	1.1	G XSlope (%)	2.9	J XSlope (%)	2.4

