


Access Compliance Report
Public Rights-of-Way
(Accessible Street Parking)

Intersection ID:	N/A	Main Street: SANDYROCK PL	Location:	OnStreet
ADA ID:	3973B0B66F0C	ParkingType:	AngParkAAMID	Overall Compliance: No
Severity Score:		0.0		
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance	

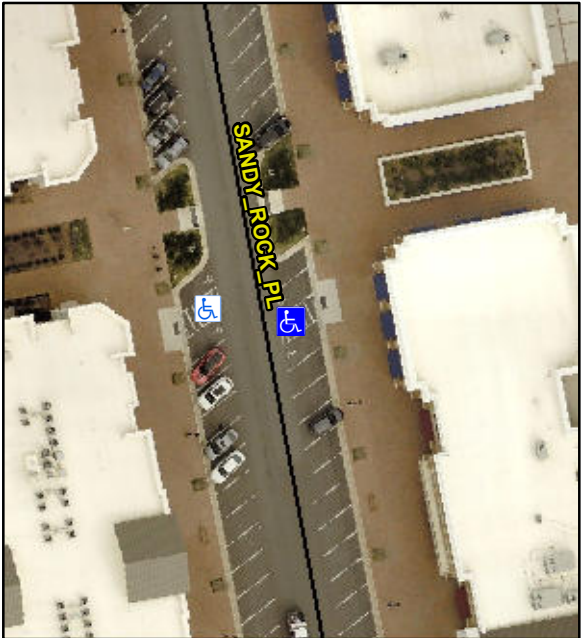


Possible Solutions:
RestripeSpotAndAisle. Provide identification sign.

Surveyor Notes:
N/A

PROW/ADA:
TBD

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	185.5	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	1.0	Yes	Access Aisle Width (in)	109.5
No	Adjacent Sidewalk XSlope (%)	2.6	No	Access Aisle Length (in)	193.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
Yes	Curb Ramp?	Yes			
No	Left Parking Spot Width (in)	108.0	No	Right Parking Spot Width (in)	108.5
No	Left Parking Spot Length (in)	193.0	No	Right Parking Spot Length (in)	193.0
N/A	Left Van Accessible?	Yes	N/A	Right Van Accessible?	Yes
No	Left Identification Sign?	Yes	No	Right Identification Sign?	Yes
N/A	Left Sign Height (in)	72.0	N/A	Right Sign Height (in)	73.0
N/A	Left Vertical Clearance (in)	N/A	N/A	Right Vertical Clearance (in)	N/A
N/A	Left Parking Meter?	No	N/A	Right Parking Meter?	No
N/A	Left Parking Meter Height (in)	N/A	N/A	Right Parking Meter Height (in)	N/A
N/A	Left Meter Operable Parts?	No	N/A	Right Meter Operable Parts?	No
N/A	Left Meter Clear Space?	No	N/A	Right Meter Clear Space?	No
N/A	Left Meter Clear Space Slope (%)	N/A	N/A	Right Meter Clear Space Slope (%)	N/A
N/A	Left Meter Clear Space XSlope (%)	N/A	N/A	Right Meter Clear Space XSlope (%)	N/A
N/A	Left Meter Forward Reach?	No	N/A	Right Meter Forward Reach?	No
N/A	Left Meter Forward Reach (in)	N/A	N/A	Right Meter Forward Reach (in)	N/A
N/A	Left Meter Parallel Reach?	No	N/A	Right Meter Parallel Reach?	No
N/A	Left Meter Parallel Reach (in)	N/A	N/A	Right Meter Parallel Reach (in)	N/A

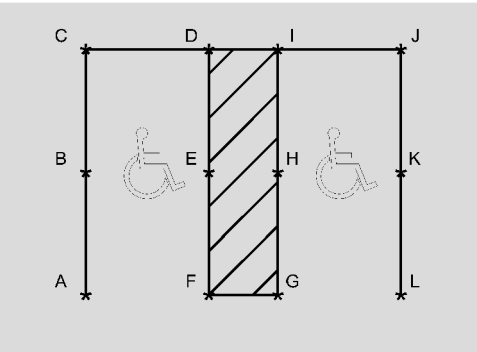

Total Cost: \$ \$0.00



No	Parking Space/Access Aisle Slopes (%)							
	C Slope (%)	2.1	D Slope (%)	1.9	I Slope (%)	2.1	L Slope (%)	0.6
	B Slope (%)	0.7	E Slope (%)	0.8	H Slope (%)	0.5	K Slope (%)	1.4
	A Slope (%)	0.7	F Slope (%)	0.7	G Slope (%)	0.0	J Slope (%)	1.1
No	Parking Space/Access Aisle XSlopes (%)							
	C XSlope (%)	4.7	D XSlope (%)	2.7	I XSlope (%)	3.2	L XSlope (%)	0.9
	B XSlope (%)	2.9	E XSlope (%)	2.4	H XSlope (%)	1.5	K XSlope (%)	2.2
	A XSlope (%)	4.1	F XSlope (%)	1.2	G XSlope (%)	1.6	J XSlope (%)	1.1