


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID:	10037212	Main Street: SANDY_ROCK_PL	Location:	OnStreet
ADA ID:	4494351C7F8C	ParkingType:	AngParkAAMID	Overall Compliance: No
Codes/Mitigation Info/Possible Solution			Severity Score: 0.0	
Field Measurements/Component Compliance				

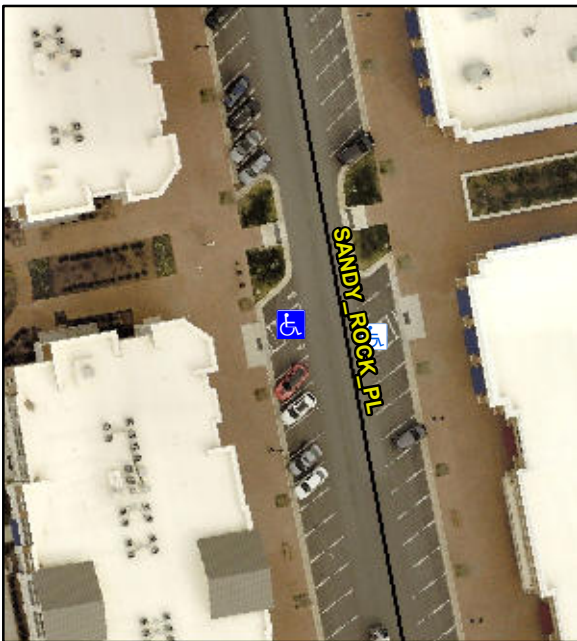

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

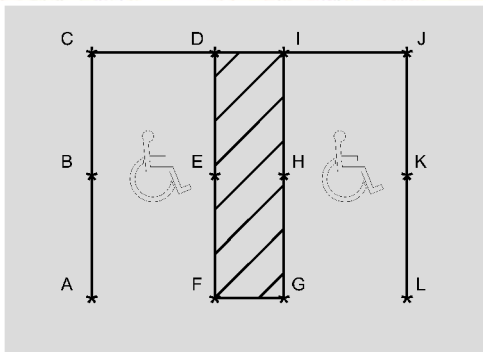

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	243.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	2.1	Yes	Access Aisle Width (in)	108.0
Yes	Adjacent Sidewalk XSlope (%)	0.7	No	Access Aisle Length (in)	191.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	N/A
Yes	Curb Ramp?	Yes			
No	Left Parking Spot Width (in)	107.0	No	Right Parking Spot Width (in)	94.0
No	Left Parking Spot Length (in)	192.0	No	Right Parking Spot Length (in)	191.0
N/A	Left Van Accessible?	Yes	N/A	Right Van Accessible?	No
No	Left Identification Sign?	Yes	No	Right Identification Sign?	Yes
N/A	Left Sign Height (in)	75.0	N/A	Right Sign Height (in)	74.0
No	Left Vertical Clearance (in)	N/A	N/A	Right Vertical Clearance (in)	N/A
N/A	Left Parking Meter?	No	N/A	Right Parking Meter?	No
N/A	Left Parking Meter Height (in)	N/A	N/A	Right Parking Meter Height (in)	N/A
N/A	Left Meter Operable Parts?	No	N/A	Right Meter Operable Parts?	No
N/A	Left Meter Clear Space?	No	N/A	Right Meter Clear Space?	No
N/A	Left Meter Clear Space Slope (%)	N/A	N/A	Right Meter Clear Space Slope (%)	N/A
N/A	Left Meter Clear Space XSlope (%)	N/A	N/A	Right Meter Clear Space XSlope (%)	N/A
N/A	Left Meter Forward Reach?	No	N/A	Right Meter Forward Reach?	No
N/A	Left Meter Forward Reach (in)	N/A	N/A	Right Meter Forward Reach (in)	N/A
N/A	Left Meter Parallel Reach?	No	N/A	Right Meter Parallel Reach?	No
N/A	Left Meter Parallel Reach (in)	N/A	N/A	Right Meter Parallel Reach (in)	N/A

No Parking Space/Access Aisle Slopes (%)

C Slope (%)	2.8	D Slope (%)	2.6	I Slope (%)	3.3	L Slope (%)	2.8
B Slope (%)	2.0	E Slope (%)	3.2	H Slope (%)	4.1	K Slope (%)	3.9
A Slope (%)	2.1	F Slope (%)	1.8	G Slope (%)	2.6	J Slope (%)	2.9

No Parking Space/Access Aisle XSlopes (%)

C XSlope (%)	0.0	D XSlope (%)	0.4	I XSlope (%)	0.2	L XSlope (%)	2.5
B XSlope (%)	0.4	E XSlope (%)	0.2	H XSlope (%)	0.0	K XSlope (%)	3.9
A XSlope (%)	0.4	F XSlope (%)	0.4	G XSlope (%)	0.7	J XSlope (%)	2.5

