


# Access Compliance Report

## Public Rights-of-Way

### (Accessible Street Parking)

Intersection ID: N/A	Main Street: N SYCAMORE ST	Location: N/A
ADA ID: 5427AE426A00	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

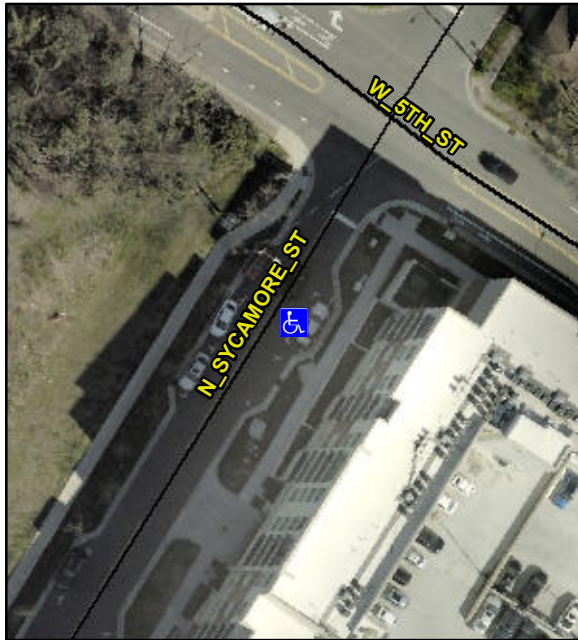

Possible Solutions:


**Advise relocating to an area with maximum 2% slopes**

Surveyor Notes:

**N/A**

PROW/ADA:

**TBD**

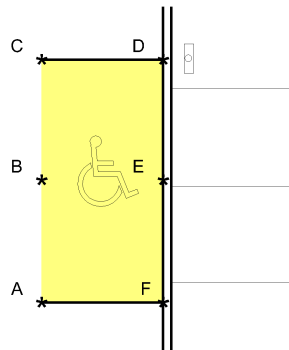

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	72.0	No	Access Aisle Marking?	Yes
No	Adjacent Sidewalk Slope (%)	5.9	No	Access Aisle Width (in)	59.0
Yes	Adjacent Sidewalk XSlope (%)	1.7	Yes	Access Aisle Length (in)	260.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	N/A
	N/A	Parking Spot Width (in)		79.0	
	N/A	Parking Spot Length (in)		260.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
	C Slope (%)	6.4	D Slope (%)	6.0	I Slope (%)	N/A
	B Slope (%)	4.5	E Slope (%)	4.5	H Slope (%)	N/A
	A Slope (%)	4.2	F Slope (%)	4.9	G Slope (%)	N/A
					J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)					
	C XSlope (%)	2.0	D XSlope (%)	0.6	I XSlope (%)	N/A
	B XSlope (%)	3.6	E XSlope (%)	1.7	H XSlope (%)	N/A
	A XSlope (%)	1.1	F XSlope (%)	0.7	G XSlope (%)	N/A
					J XSlope (%)	N/A
					K XSlope (%)	N/A
					L XSlope (%)	N/A

