

Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: 47312	Main Street: S_DAVIDSON_ST	Location: N/A
ADA ID: 586ECE572D4F	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance



Possible Solutions:

Advise relocating to an area with maximum 2% slopes


Surveyor Notes:

N/A

PROW/ADA:

TBD

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	Yes	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	179.0	No	Access Aisle Marking?	Yes
Yes	Adjacent Sidewalk Slope (%)	2.0	No	Access Aisle Width (in)	55.0
Yes	Adjacent Sidewalk XSlope (%)	1.7	Yes	Access Aisle Length (in)	259.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		80.0	
	N/A	Parking Spot Length (in)		259.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

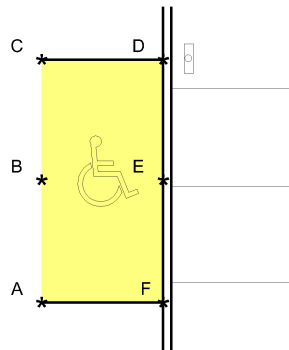

Total Cost: \$ \$0.00

N/A	Parking Space/Access Aisle Slopes (%)						
C Slope (%)	1.2	D Slope (%)	1.1	I Slope (%)	N/A	L Slope (%)	N/A
B Slope (%)	1.3	E Slope (%)	1.3	H Slope (%)	N/A	K Slope (%)	N/A
A Slope (%)	1.7	F Slope (%)	0.3	G Slope (%)	N/A	J Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)						
C XSlope (%)	2.0	D XSlope (%)	0.3	I XSlope (%)	N/A	L XSlope (%)	N/A
B XSlope (%)	0.8	E XSlope (%)	0.8	H XSlope (%)	N/A	K XSlope (%)	N/A
A XSlope (%)	2.4	F XSlope (%)	1.4	G XSlope (%)	N/A	J XSlope (%)	N/A

