


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID: 10040668	Main Street: W MARTIN LUTHER KING JR BV	Location: N/A
ADA ID: 608515ED63D7	ParkingType: ParaPark	Overall Compliance: No
		Severity Score: 0.0
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance

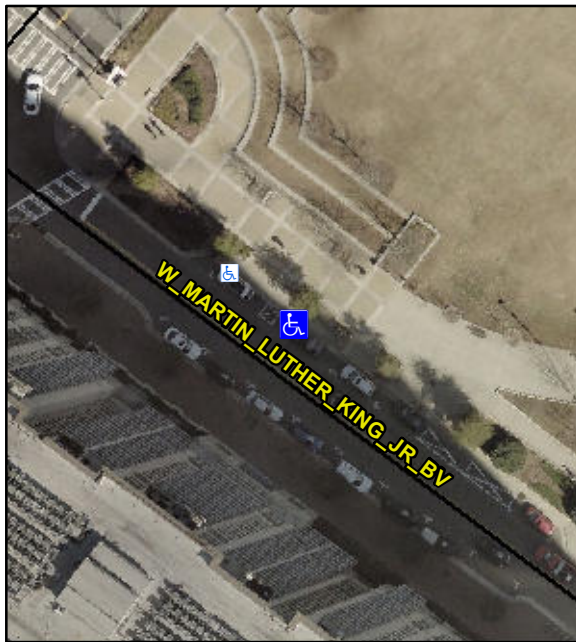

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

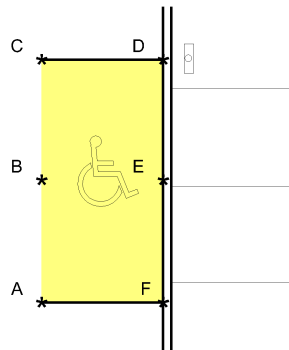

Total Cost: \$ **\$0.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	No	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	184.0	N/A	Access Aisle Marking?	Yes
No	Adjacent Sidewalk Slope (%)	3.0	Yes	Access Aisle Width (in)	62.0
No	Adjacent Sidewalk XSlope (%)	3.5	No	Access Aisle Length (in)	256.0
Yes	Adjacent Sidewalk Clear of Obstr.	Yes	N/A	Access Aisle Location	Side
	N/A	Parking Spot Width (in)		90.5	
	N/A	Parking Spot Length (in)		360.0	
	N/A	Van Accessible?		N/A	
	Yes	Curb Ramp?		Yes	
	N/A	Identification Sign?		N/A	
	N/A	Sign Height (in)		N/A	
	N/A	Vertical Clearance		N/A	
	N/A	Parking Meter?		N/A	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		N/A	
	N/A	Meter Clear Space?		N/A	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		N/A	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		N/A	
	N/A	Meter Parallel Reach (in)		N/A	

N/A	Parking Space/Access Aisle Slopes (%)					
	C Slope (%)	3.2	D Slope (%)	3.4	I Slope (%)	N/A
	B Slope (%)	4.1	E Slope (%)	3.3	H Slope (%)	N/A
	A Slope (%)	3.1	F Slope (%)	3.5	G Slope (%)	N/A
N/A	Parking Space/Access Aisle XSlopes (%)					
	C XSlope (%)	2.4	D XSlope (%)	6.5	I XSlope (%)	N/A
	B XSlope (%)	2.7	E XSlope (%)	7.4	H XSlope (%)	N/A
	A XSlope (%)	3.5	F XSlope (%)	5.0	G XSlope (%)	N/A
					L Slope (%)	N/A
					K Slope (%)	N/A
					J Slope (%)	N/A
					L XSlope (%)	N/A
					K XSlope (%)	N/A
					J XSlope (%)	N/A

