


Access Compliance Report

Public Rights-of-Way

(Accessible Street Parking)

Intersection ID:	N/A	Main Street:	COMMONWEALTH AV	Location:	OnStreet		
ADA ID:	73BB6AF0106F	ParkingType:	AngParkAALT	Overall Compliance:	No	Severity Score:	0.0

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance			
---	--	--	--	---	--	--	--

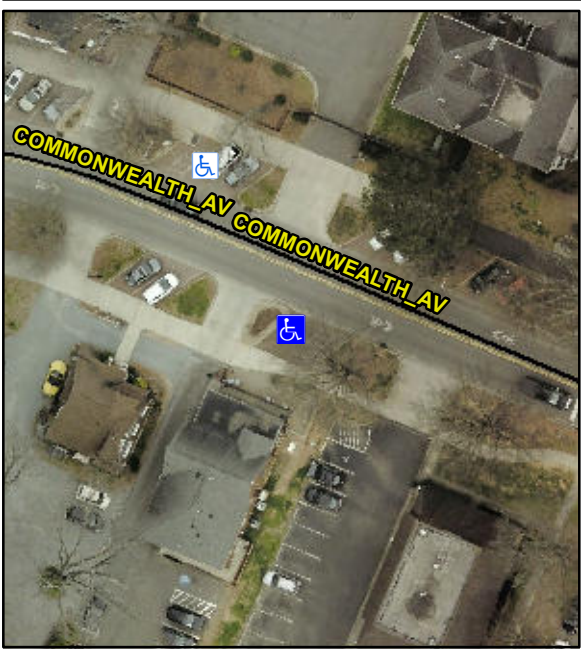

Possible Solutions:


Advise relocating to an area with maximum 2% slopes

Surveyor Notes:

N/A

PROW/ADA:

TBD

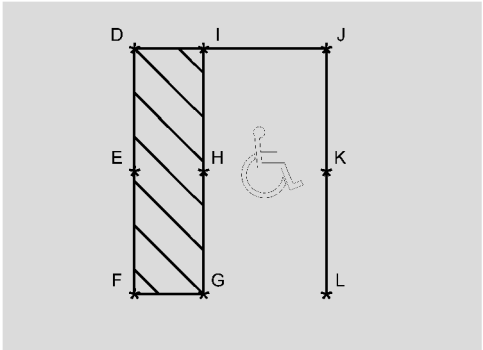

Total Cost:

\$0.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Parking Spot At End of Block?	N/A	Yes	Accessible Route?	Yes
Yes	Adjacent Sidewalk Width (in)	64.0	No	Access Aisle Marking?	Yes
No	Adjacent Sidewalk Slope (%)	3.5	No	Access Aisle Width (in)	60.0
No	Adjacent Sidewalk XSlope (%)	3.0	No	Access Aisle Length (in)	253.0
N/A	Adjacent Sidewalk Clear of Obstr.	N/A	N/A	Access Aisle Location	Side
	No	Parking Spot Width (in)		133.0	
	No	Parking Spot Length (in)		253.0	
	N/A	Van Accessible?		No	
	Yes	Curb Ramp?		Yes	
	No	Identification Sign?		Yes	
	N/A	Sign Height (in)		67.5	
	No	Vertical Clearance		N/A	
	N/A	Parking Meter?		No	
	N/A	Parking Meter Height (in)		N/A	
	N/A	Meter Operable Parts?		No	
	N/A	Meter Clear Space?		No	
	N/A	Meter Clear Space Slope (%)		N/A	
	N/A	Meter Clear Space XSlope (%)		N/A	
	N/A	Meter Forward Reach?		No	
	N/A	Meter Forward Reach (in)		N/A	
	N/A	Meter Parallel Reach?		No	
	N/A	Meter Parallel Reach (in)		N/A	

No Parking Space/Access Aisle Slopes (%)

C Slope (%)	N/A	D Slope (%)	1.1	I Slope (%)	2.8	L Slope (%)	1.5
B Slope (%)	N/A	E Slope (%)	2.3	H Slope (%)	1.4	K Slope (%)	3.4
A Slope (%)	N/A	F Slope (%)	1.8	G Slope (%)	0.6	J Slope (%)	3.1

No Parking Space/Access Aisle XSlopes (%)

C XSlope (%)	N/A	D XSlope (%)	0.4	I XSlope (%)	1.5	L XSlope (%)	0.9
B XSlope (%)	N/A	E XSlope (%)	2.8	H XSlope (%)	2.8	K XSlope (%)	3.0
A XSlope (%)	N/A	F XSlope (%)	1.8	G XSlope (%)	1.4	J XSlope (%)	0.3

